



**FEDERAL AVIATION ADMINISTRATION
AIRWORTHINESS DIRECTIVES
SMALL AIRCRAFT, ROTORCRAFT, GLIDERS,
BALLOONS, & AIRSHIPS**

BIWEEKLY 2012-09

This electronic copy may be printed and used in lieu of the FAA biweekly paper copy.

U.S. Department of Transportation
Federal Aviation Administration
Engineering Procedures Office, AIR-110
P. O. Box 25082
Oklahoma City, OK 73125-0460

SMALL AIRCRAFT, ROTORCRAFT, GLIDERS, BALLOONS, & AIRSHIPS

AD No.	Information	Manufacturer	Applicability
Info: E - Emergency; COR - Correction; S - Supersedes; R - Revision; - See AD for additional information;			
Biweekly 2012-01			
2010-19-06 R1	COR	Turbomeca	Engine: Arriel 1A, 1A1, 1B, 1C, 1C1, 1C2, 1D, 1D1, and IS1 turboshaft
2011-26-10		Enstrom Helicopter Corporation	Rotorcraft: F-28C, F-28C-2, F-28F, 280C, 280F, 280FX, TH-28, 480, and 480B
2011-27-09		Socata	TBM 700
2012-01-01		Various Aircraft	See AD
2012-01-02		Schempp-Hirth Flugzeugbau	Glider: Discus 2cT
Biweekly 2012-02			
2011-18-12	S 82-13-05R1	Eurocopter France	Rotorcraft: AS350B, B1, B2, B3, BA, and D; and AS355E, F, F1, F2, and N
2011-27-08		Agusta S.p.A.	Rotorcraft: A109S and AW109SP
2011-27-51		Hawker Beechcraft	1900, 1900C, 1900C (Military), 1900D
2012-01-07		BRP-Powertrain GmbH	Engine: Rotax 914 F2, 914 F3, and 914 F4 reciprocating
2012-01-11		Cirrus Design	SR22T
2012-02-05		Thielert Aircraft Engines GmbH	Engine: TAE 125-02-99 and TAE-125-02-114 reciprocating
Biweekly 2012-03			
71-13-01R1		Lycoming Engines	Engine: TIO-540-A series
2012-01-03		Eurocopter France	Rotorcraft: AS332L2 and EC225LP
2012-02-02	S 2008-03-02	Cessna	172R and 172S
2012-02-06		Honeywell International	Engine: TPE331-10, -10AV, -10GP, -10GT, -10N, -10P, -10R, -10T, -10U, -10UA, -10UF, -10UG, -10UGR, -10UR, and TPE331-11U
2012-02-10	S 2011-07-13	CPAC	112, 112B, 112TC, 112TCA, 114, 114A, 114B, and 114TC
2012-02-13		Eurocopter France	Rotorcraft: EC130B4
2012-02-51	E	Bell Helicopter Textron Canada Limited	Rotorcraft: 206L, L-1, L-3, and L-4
2012-03-06	S 2011-15-10	Superior Air Parts, Lycoming Engines, and Continental Motors	Engine: Fuel injected reciprocating engines
2012-03-52	E	Mooney Aviation	M20TN and M20R
Biweekly 2012-04			
2012-03-01		Eurocopter Deutschland	Rotorcraft: EC135 helicopters
2012-03-07		Lycoming Engines	Engine: See AD
2012-03-11	S 2010-03-06	Turbomeca S.A.	Engine: Arriel 2B and 2B1 turboshaft engines
Biweekly 2012-05			
2010-11-09R1	R	Thielert Aircraft Engines GmbH	Engine: TAE 125-01 and TAE 125-02-99 reciprocating engines
2011-12-10	COR	Robinson Helicopter Company	R22, R22 Alpha, R22 Beta, and R22 Mariner helicopters; R44 and R44 II helicopters
2011-27-04	COR	Hawker Beechcraft Corporation	95-C55, D55, E55, 58, and 58A airplanes
2012-03-52		Mooney	M20R and M20TN airplanes
2012-04-03		BRP-Powertrain GmbH & Co. KG	912 S2 and 912 S3 reciprocating engines; 914 F2 reciprocating engines
Biweekly 2012-06			
2012-04-10		Burl A. Rogers	15AC and S15AC airplanes
2012-05-01		Eurocopter France	SA-365C, SA-365C1, SA-365C2, SA-365N, SA-365N1, AS-365N2, AS 365 N3, and SA-366G1 helicopters
2012-05-09	S 2012-03-52	Mooney Aviation	M20B, M20C, M20D, M20E, M20F, M20G, M20J, M20K, M20L, M20M, M20R, M20S, and M20TN airplanes

SMALL AIRCRAFT, ROTORCRAFT, GLIDERS, BALLOONS, & AIRSHIPS

AD No.	Information	Manufacturer	Applicability
--------	-------------	--------------	---------------

Info: E - Emergency; COR - Correction; S - Supersedes; R - Revision; - See AD for additional information;

Biweekly 2012-07

2012-06-13		DG Flugzeugbau GmbH	Gliders: DG-500 Elan Orion, DG-500 Elan Trainer, DG-500/20 Elan, DG-500/22 Elan, DG-500M, and DG-500MB
2012-06-16		Pilatus Aircraft	PC-6, PC-6-HI, PC-6-H2, PC-6/350, PC-6/350-HI, PC-6/350-H2, PC-6/A, PC-6/A-HI, PC-6/A-H2, PC-6/B-H2, PC-6/B1-H2, PC-6/B2-H2, PC-6/B2-H4, PC-6/C-H2, and PC-6/CI-H2
2012-07-01		Agusta S.p.A.	Rotorcraft: AB412

Biweekly 2012-08

2011-18-52		Agusta S.p.A.	AB139 and AW139 helicopters
2012-02-51		Bell Helicopter Textron Canada Limited	206L, 206L-1, 206L-3, and 206L-4 helicopters
2012-06-15		DG Flugzeugbau GmbH	DG-500 Elan Orion, DG-500 Elan Trainer, DG-500/20 Elan, and DG-500/22 Elan sailplanes, DG-500M and DG-500MB powered sailplanes
2012-06-24		Sikorsky	S-92A helicopters
2012-07-09	S 2009-14-11	Turbomeca S.A.	Arrius 2F turboshaft engines
2012-08-01		Sikorsky	S-92A helicopters

Biweekly 2012-09

2012-08-18		Turbomeca	Arriel 2B and 2B1 turboshaft engines
------------	--	-----------	--------------------------------------



2012-08-18 Turbomeca S.A: Amendment 39-17035; Docket No. FAA-2012-0010; Directorate Identifier 2012-NE-03-AD.

(a) Effective Date

This AD is effective May 30, 2012.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Turbomeca S.A. Arriel 2B and 2B1 turboshaft engines with at least one installed power turbine (PT) blade part number (P/N) 2 292 81 A01 0, serial numbers (S/Ns) 102782 through 120230 inclusive, or, S/Ns 120293 through 120390 inclusive.

(d) Reason

This AD was prompted by the detection of geometric non-conformities on PT blade fir-tree roots. We are issuing this AD to prevent PT blade rupture, which could result in an uncommanded in-flight engine shutdown, forced autorotation landing, or accident.

(e) Actions and Compliance

Unless already done, do the following actions within 5,000 flight cycles-since-new (CSN) on the PT blades, or within one month after the effective date of this AD, whichever occurs later.

- (1) Replace the PT blades with PT blades eligible for installation; or
- (2) Replace the M04 module with an M04 module having PT blades eligible for installation; or
- (3) Replace the PT wheel assembly with a PT wheel assembly having PT blades eligible for installation.
- (4) Guidance on the replacements specified in paragraphs (e)(1) through (e)(3) can be found in Turbomeca S.A. Alert Mandatory Service Bulletin No. A292 72 2842, Version A, dated September 23, 2011.

(f) Definition

For the purposes of this AD, a PT blade eligible for installation is one not listed in paragraph (c) of this AD or, one listed in paragraph (c) of this AD with fewer than 5,000 flight CSN.

(g) Installation Prohibition

From the effective date of this AD:

- (1) Do not install a PT blade as listed in paragraph (c) of this AD, that has 5,000 or more flight CSN, into any engine.

(2) Do not install any engine with a PT blade as listed in paragraph (c) of this AD, that has 5,000 or more flight CSN, onto a helicopter.

(h) Alternative Methods of Compliance (AMOCs)

The Manager, Engine Certification Office, may approve AMOCs for this AD. Use the procedures found in 14 CFR 39.19 to make your request.

(i) Related Information

(1) For more information about this AD, contact Rose Len, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7772; fax: 781-238-7199; email: rose.len@faa.gov.

(2) Refer to MCAI EASA Airworthiness Directive 2011-0218, dated November 10, 2011, and Turbomeca S.A. Alert Mandatory Service Bulletin No. A292 72 2842, Version A, dated September 23, 2011, for related information.

(3) For service information identified in this AD, contact Turbomeca, 40220 Tarnos, France; phone: 33 05 59 74 40 00; fax: 33 05 59 74 45 15. You may review copies of the referenced service information at the FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

(j) Material Incorporated by Reference

None.

Issued in Burlington, Massachusetts, on April 17, 2012.
Peter A. White,
Manager, Engine & Propeller Directorate,
Aircraft Certification Service.