

**FEDERAL AVIATION ADMINISTRATION  
AIRWORTHINESS DIRECTIVES**

**LARGE AIRCRAFT**

**BIWEEKLY 2020-20**

*9/14/2020 - 9/27/2020*



Federal Aviation Administration  
Continued Operational Safety Policy Section, AIR-141  
P.O. Box 25082  
Oklahoma City, OK 73125-0460

## CHANGE OF ADDRESS NOTICE

Any change of address regarding the biweekly service must include the mailing label from a recent issue or your name and address printed exactly as they appear on the mailing label (including the computer number above the address).

Please allow one month for an address change.

### MAIL YOUR ADDRESS CHANGE TO:

Superintendent of Documents  
Government Printing Office  
Mail List Branch SSOM  
Washington, DC 20402

Telephone: (202) 512-1806  
Facsimile: (202) 512-2250

## LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
<b>Biweekly 2020-01</b>			
2019-23-04		The Boeing Company	727, 727-100, 727C, 727-100C, 727-200, and 727-200F
2019-23-16		The Boeing Company	737-100, -200, -200C, -300, -400, and -500
2019-24-12		De Havilland Aircraft of Canada Limited	DHC-8-401 and -402
2019-24-13		Airbus SAS	A318-111, -112, -121, and -122, A319-111, -112, -113, -114, -115, -131, -132, and -133, A320-211, -212, -214, -216, -231, -232, and -233, A321-111, -112, -131, -211, -212, -213, -231, and -232
2019-24-14		328 Support Services GmbH	328-100
2019-24-15		The Boeing Company	737-900ER
2019-24-16	R 2017-16-08	Embraer S.A	ERJ 190-100 STD, -100 LR, -100 ECJ, and -100 IGW, ERJ 190-200 STD, -200 LR, and -200 IGW
2019-24-18		The Boeing Company	727, 727C, 727-100, 727-100C, 727-200, and 727-200F, 757-200, -200PF, -200CB, and -300, 767-200, -300, -300F, and -400ER
2019-25-13		Engine Alliance	GP7270 and GP7277
2019-25-17		The Boeing Company	737-600, -700, -700C, -800, -900, and -900ER
<b>Biweekly 2020-02</b>			
2019-22-07		Bombardier, Inc	CL-600-2B19 (Regional Jet Series 100 & 440), CL-600-2C10 (Regional Jet Series 700, 701 & 702), CL-600-2D15 (Regional Jet Series 705), Model CL-600-2D24 (Regional Jet Series 900), Model CL-600-2E25 (Regional Jet Series 1000)
2019-23-14		The Boeing Company	37-100, -200, -200C, -300, -400, and -500
2019-24-01		Airbus SAS	A318-111, -112, -121, and -122, A319-111, -112, -113, -114, -115, -131, -132, and -133, A320-211, -212, -214, -231, -232, and -233, A321-111, -112, -131, -211, -231, -212, -213, and -232, A330-201, -202, -203, -223, -223F, -243, and -243F, A340-211, -212, -213, -311, -312, -313, -541, and -642
2019-25-10		Fokker Services B.V	F28 Mark 0070 and 0100
2019-25-11		Viking Air Limited	CL-215-1A10, CL-215-6B11 (CL-215T Variant)
2019-25-12	R 2016-18-02	The Boeing Company	777-200 and -300ER
2019-25-14		The Boeing Company	777-300ER and 777F
2019-25-15		Fokker Services B.V	F28 Mark 0100
2019-25-16	R 2017-06-08	Embraer S.A	ERJ 170-100 LR, -100 STD, -100 SE, and -100 SU airplanes; and Model ERJ 170-200 LR, -200 SU, -200 STD, and -200 LL
2019-25-18		Bombardier, Inc	CL-600-2B19 (Regional Jet Series 100 & 440)
2019-25-19		Airbus SAS	A350-941
2020-01-11	R 2017-12-07	The Boeing Company	737-800, -900, and -900ER
2020-01-55	E	General Electric Company	GE90-110B1 and GE90-115B
<b>Biweekly 2020-03</b>			
2019-25-20		Lockheed Martin Corporation/Lockheed Martin Aeronautics Company	382, 382B, 382E, 382F, and 382G; C-130A, C-130B, C-130BL, C-130E, C-130H, C-130H-30, C-130J, C-130J-30, EC-130Q, HC-130H, KC-130H, NC-130B, NC-130, and WC-130H airplanes
2019-25-55		The Boeing Company	737-300, -400, and -700 series airplanes
2019-26-01		Airbus SAS	A350-941 and -1041 airplanes
2020-01-12	A 2017-16-12	Airbus SAS	A318, A319, A320, A321 airplanes
2020-01-13	R 2018-19-26	Dassault Aviation	MYSTERE-FALCON 200 airplanes
2020-01-14	A 2010-26-05	Airbus SAS	A300 B2-1A, B2-1C, B2K-3C, B2-203, B4-2C, B4-103, and B4-203 airplanes
2020-01-17		Airbus SAS	A318, A319, A320, A321 airplanes
2020-01-18	R 2006-11-11	The Boeing Company	757-200, -200PF, -200CB, and -300 series airplanes

## LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
--------	-------------	--------------	---------------

Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects

### Biweekly 2020-04

2019-26-10		Bombardier, Inc.	CL-600-2C10, -2D15, -2D25, -2E25 airplanes
2019-26-11		Airbus SAS	A319, A320, A321 airplanes
2020-01-10		Airbus SAS	A350-941 airplanes
2020-01-15		Airbus SAS	A300, A310 airplanes
2020-01-16	A 2014-25-52	Airbus SAS	A330, A340 airplanes
2020-01-55		General Electric Company	GE90-110B1 and GE90-115B model turbofan engines
2020-02-10		De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402 airplanes
2020-02-12	R 2017-15-04	The Boeing Company	787 series airplanes
2020-02-13	R 2019-03-14 A 2010-26-05	Dassault Aviation	FAN JET FALCON, FAN JET FALCON SERIES C, D, E, F, and G airplanes
2020-02-14		Airbus SAS	A350-941 and -1041 airplanes
2020-02-15		Bombardier, Inc.	BD-700-1A10, BD-700-1A11 airplanes
2020-02-16		The Boeing Company	737-200, -200C, -300, -400, and -500 series airplanes
2020-02-18		Gulfstream Aerospace Corporation	GVI, GVII-G500, and GVII-G600 airplanes
2020-02-19	R 2003-09-04 R1	Bombardier, Inc.	CL-600-2B19 airplanes
2020-02-20	R 2014-24-07	Airbus SAS	A318, A319, A320, A321 airplanes
2020-02-21	R 2014-03-12 R 2018-19-25 A 2010-26-05	Dassault Aviation	FALCON 2000 airplanes
2020-02-22		Airbus SAS	A300, A310 airplanes
2020-03-11		The Boeing Company	707-100 long body, -200, -100B long body, -100B short body, -300, -300B, -300C, and -400 series; and 720 and 720B series airplanes
2020-03-12		Airbus SAS	A350-941 and -1041 airplanes

### Biweekly 2020-05

2020-01-18	COR R 2006-11-11	The Boeing Company	757-200, -200PF, -200CB, and -300 series airplanes
2020-02-19	COR R 2003-09-04 R1	Bombardier, Inc.	CL-600-2B19 (Regional Jet series 100 & 440) airplanes
2020-03-10		The Boeing Company	737 series, except for 737-100, -200, -200C, -300, -400, and -500 series airplanes
2020-03-14		Airbus SAS	A350-941 and -1041 airplanes
2020-03-15		Airbus SAS	A321-211, -212, -213, -231, and -232 airplanes
2020-03-17	R 2015-24-04	Bombardier, Inc.	CL-600-2B19, -2C10, -2D15, -2D25, -2E25 airplanes
2020-03-18	R 2017-19-08	Airbus Defense and Space S.A.	C-212-CB, C-212-CC, C-212-CD, C-212-CE, and C-212-DF airplanes
2020-03-19	A 2010-26-05	Dassault Aviation	MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes
2020-03-20		The Boeing Company	MD-11, MD-11F, 717-200, 737-8, 737-9, 737-600, -700, -700C, -800, -900, and -900ER; 747-400 and 747-400F; 757-200, -200PF, -200CB, and -300; 767-200, -300, -300F, -400ER, and -2C; 777-200, -200LR, -300, and -300ER; 777F series airplanes
2020-03-21		Bombardier, Inc.	BD-700-1A10 and BD-700-1A11 airplanes
2020-03-22		The Boeing Company	787-8 airplanes
2020-03-23		Bombardier, Inc.	CL-600-2B19
2020-03-24	A 2010-26-05	Dassault Aviation	MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes
2020-04-01		Pratt & Whitney	PW1519G, PW1521G, PW1521GA, PW1524G, PW1525G, PW1521G-3, PW1524G-3, PW1525G-3, PW1919G, PW1921G, PW1922G, PW1923G, and PW1923G-A model turbofan engines

### Biweekly 2020-06

2020-04-10	A 2011-03-10	Airbus SAS	A330 airplanes
2020-04-11		The Boeing Company	747-400 series airplanes
2020-04-12	R 2012-22-05 R 2018-19-03	Fokker Services B.V.	F28 Mark 0070 and 0100 airplanes
2020-04-18		Airbus SAS	A330-941 airplanes

## LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
2020-05-01		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-AE3, Trent 1000-CE3, Trent 1000-D3, Trent 1000-G3, Trent 1000-H3, Trent 1000-J3, Trent 1000-K3, Trent 1000-L3, Trent 1000-M3, Trent 1000-N3, Trent 1000-P3, Trent 1000-Q3, and Trent 1000-R3 model turbofan engines
2020-05-10		Dassault Aviation	FALCON 7X airplanes
2020-05-12		Gulfstream Aerospace Corporation	GVII-G500 and GVII-G600 airplanes
2020-05-13		Airbus Canada Limited Partnership	BD-500-1A11 airplanes
2020-05-14		Airbus SAS	A320-214, -232, -271N; A321-231 airplanes
2020-05-18		Airbus SAS	A350-941 and -1041 airplanes
2020-06-01	R 2018-25-09 R 2019-12-01	CFM International, S.A.	LEAP-1B21, -1B23, -1B25, -1B27, -1B28, -1B28B1, -1B28B2, -1B28B3, -1B28B2C, -1B28BBJ1, and -1B28BBJ2 model turbofan engines
<b>Biweekly 2020-07</b>			
2020-04-19	R 2017-15-01	The Boeing Company	777-200, -200LR, -300, -300ER, and 777F series airplanes
2020-05-13		Airbus Canada Limited Partnership	BD-500-1A11 airplanes
2020-05-14		Airbus SAS	A320-214, -232, -271N; A321-231 airplanes
2020-05-15		Airbus SAS	A319-131, -132, -133; A320-231, -232, -233; and A321-131, -231, -232 airplanes
2020-05-16		Airbus SAS	A319-115; A320-214, -216, -232, -251N, -271N; and A321-211, -231, -251N, -251NX, -253N, -271N, -271NX, -272N airplanes
2020-05-17		Airbus SAS	A318-112, A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-216, A320-231, A320-232, A320-233, A320-251N, and A320-271N airplanes
2020-05-18		Airbus SAS	A350-941 and -1041 airplanes
2020-05-19		Airbus SAS	A319-112, -115, -132; and A320-214, -216, -232 -233 airplanes
2020-05-21		Yaborã Indústria Aeronáutica S.A.	ERJ 190-100 STD, -100 LR, -100 ECJ, -100 IGW, -200 STD, -200 LR, and -200 IGW airplanes
2020-05-22		Yaborã Indústria Aeronáutica S.A.	ERJ 170-100 LR, -100 STD, -100 SE, -100 SU; and ERJ 170-200 LR, -200 SU, -200 STD, -200 LL airplanes
2020-05-24	R 2010-26-01	The Boeing Company	777-200 series airplanes
2020-05-28	R 2019-11-08	International Aero Engines LLC	PW1133G-JM, PW1133GA-JM, PW1130G-JM, PW1129G-JM, PW1127G-JM, PW1127GA-JM, PW1127G1-JM, PW1124G-JM, PW1124G1-JM, and PW1122G-JM turbofan engines
2020-06-02		International Aero Engines LLC	PW1122G-JM, PW1124G1-JM, PW1124G-JM, PW1127GA-JM, PW1127G1-JM, PW1127G-JM, PW1133G-JM, PW1133GA-JM, PW1130G-JM, and PW1129G-JM turbofan engines
2020-06-14		The Boeing Company	787-8, 787-9, and 787-10 airplanes
2020-07-51	E	International Aero Engines AG	V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, and V2533-A5 turbofan engines
<b>Biweekly 2020-08</b>			
2020-04-15		The Boeing Company	757-200, -200PF, -200CB, and -300 series; 767-200, -300, and -300F series airplanes
2020-04-16		Yaborã Indústria Aeronáutica S.A.	ERJ 190-100 STD, -100 LR, -100 IGW, -200 STD, -200 LR, and -200 IGW airplanes
2020-04-17		Airbus SAS Model	A350-941 and -1041 airplanes
2020-04-20		De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402 airplanes
2020-04-22	R 2018-19-27 R 2014-16-12 A 2010-26-05	Dassault Aviation	FALCON 2000EX airplanes
2020-05-25		The Boeing Company	757-200, -200PF, -200CB, and -300 series airplanes
2020-05-26		The Boeing Company	787-8 airplanes

## LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
2020-05-27 2020-06-10		Bombardier, Inc. Airbus SAS	BD-700-1A10 and BD-700-1A11 airplanes A318-111, -112, -121, and -122; A319-111, -112, -112, -113, -114, -115, -131, -132, and -133; A320-211, -212, -214, -216, -231, -232, and -233; A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes
2020-06-15 2020-06-16	R 2017-03-02	Fokker Services B.V. Rolls-Royce Deutschland Ltd. & Co. KG	F28 Mark 0100 airplanes RB211 Trent 768-60, 772-60, and 772B-60 turbofan engines
2020-06-17	R 2011-09-06	Airbus SAS	A330-223F and -243F; A330-201, -202, -203, -223, and -243; A330-301, -302, -303, -321, -322, -323, -341, -342, and -343; A330-941; A340-211, -212, and -213; A340-311, -312, and -313; A340-541 and -642 airplanes
2020-06-18		Airbus SAS	A318-111, -112, -121, and -122; A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N; A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N; A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX airplanes
2020-07-02		Pratt & Whitney	PW1519G, PW1521G, PW1521G-3, PW1521GA, PW1524G, PW1524G-3, PW1525G, and PW1525G-3 turbofan engines
2020-07-10 2020-08-01		Airbus SAS General Electric Company	A320-271N; A321-271N, -271NX, and -272N airplanes CF34-1A, CF34-3A, CF34-3A1, CF34-3A2, CF34-3B, and CF34-3B1 turbofan engines
<b>Biweekly 2020-09</b>			
2020-07-11		ATR–GIE Avions de Transport Regional	ATR42-200, -300, -320, and -500; ATR72-101, -102, -201, -202, -211, -212, and -212A
2020-07-12		ATR–GIE Avions de Transport Regional	ATR42-500
2020-07-13 2020-07-14		Bombardier, Inc The Boeing Company	BD-100-1A10 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series
2020-07-16	R 2016-16-09 R 2019-03-20 A 2014-16-23	Dassault Aviation	FALCON 7X
2020-07-17 2020-07-18	R 2017-05-12	Saab AB, Support and Services Airbus SAS	SAAB 2000 A318-112; A319-111, -112, -115, -132, and -133; A320-214, -216, -232, and -233; A321-211, -212, -213, -231, and -232
2020-07-19		ATR–GIE Avions de Transport Regional	ATR72-101, -102, -201, -202, -211, -212, and -212A
2020-07-20	R 2004-06-01 R 2009-06-09 A 2008-17-01 R1 A 2012-01-08	Support Services GmbH	328-100
2020-07-21		Yabora Industria Aeronautica S.A.	ERJ 170-100 LR, -100 STD, -100 SE, and -100 SU; ERJ 170-200 LR, -200 SU, -200 STD, and -200 LL; ERJ 190-100 STD, -100 LR, -100 ECJ, -100 IGW, -200 STD, -200 LR, and -200 IGW
2020-07-51		International Aero Engines AG	V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, and V2533-A5
2020-08-02		Thales AVS France SAS	Global Positioning System/Satellite Based Augmentation System receivers
2020-08-03	R 2008-22-24	Rolls-Royce Deutschland Ltd & Co KG	RB211-535E4-37, RB211-535E4-B-37, RB211-535E4-C-37, and RB-211-535E4-B-75
2020-08-04		International Aero Engines LLC	PW1133G-JM, PW1133GA-JM, PW1130G-JM, PW1129G-JM, PW1127G-JM, PW1127GA-JM, PW1127G1-JM, PW1124G-JM, PW1124G1-JM, and PW1122G-JM
2020-09-03		International Aero Engines AG	V2500-A1, V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, V2531-E5, and V2533-A5

## LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
--------	-------------	--------------	---------------

Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects

### Biweekly 2020-10

2020-08-11		Yabora Industria Aeronautica S.A.	ERJ 190-300 and ERJ 190-400
2020-08-12		The Boeing Company	747-8 and 747-8F series
2020-08-13		Bombardier, Inc.	CL-600-2B19 (Regional Jet Series 100 & 440); CL-600-2C10 (Regional Jet Series 700, 701 & 702); CL-600-2D15 (Regional Jet Series 705), and CL-600-2D24 (Regional Jet Series 900)

### Biweekly 2020-11

2020-06-19		The Boeing Company	727, 727C, 727-100, 727-100C, 727-200, and 727-200F series
2020-09-10	R 2018-25-04	Airbus Canada Limited Partnership	BD-500-1A10; BD-500-1A11
2020-09-11	R 2017-06-06 R 2019-12-10 A 2012-12-07	Fokker Services B.V.	F28 Mark 0070 and 0100
2020-09-12		De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402 series
2020-09-13	A 2009-01-06 R1 A 2012-01-08	328 Support Services GmbH	328-300
2020-09-14	R 2020-03-12	Airbus SAS	A350-941 and -1041
2020-09-16	R 2000-17-09 R 2008-04-19 R1 R 2015-26-09 A 2018-18-05	ATR-GIE Avions de Transport Regional	ATR42-200, -300, and -320
2020-10-04		General Electric Company	GE90-110B1 and GE90-115B
2020-10-05		Rockwell Collins, Inc.	Flight Management Systems
2020-10-10	R 2016-07-28	The Boeing Company	DC-9-81 (MD-81), DC-9-82 (MD-82), DC-9-83 (MD-83), and DC-9-87 (MD-87)
2020-11-04		Learjet Inc.	60

### Biweekly 2020-12

2020-11-11		The Boeing Company	777-200, -200LR, -300, -300ER, and 777F series
2020-12-03		Rolls-Royce Deutschland Ltd & Co KG	Trent XWB-97

### Biweekly 2020-13

2020-11-10		Bombardier, Inc.	BD-100-1A10
2020-11-13	R 2010-23-04	De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402
2020-11-14		Bombardier, Inc.	BD-100-1A10
2020-12-01		Rolls-Royce Deutschland Ltd & Co KG	Trent XWB-75, XWB-79, XWB-79B, and XWB-84
2020-12-06		Gulfstream Aerospace Corporation	G-IV
2020-13-04	R 2017-09-06	General Electric Company	GENx-1B and GENx-2B

### Biweekly 2020-14

2020-11-01		Gulfstream Aerospace Corporation	GVI
2020-11-12		The Boeing Company	737-8 and 737-9
2020-13-06		Pratt & Whitney Canada Corp.	PW150A
2020-13-07		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-D2, Trent 1000-J2, and Trent 1000-K2
2020-14-02		The Boeing Company	747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series

### Biweekly 2020-15

2020-12-11		Airbus SAS	A319-111, -112, -113, -114, -115, -151N, -153N; A320-251N, -252N, -253N, -271N, -272N, -273N; A321-251N, -
------------	--	------------	------------------------------------------------------------------------------------------------------------

## LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
2020-12-12		Yabora Industria Aeronautica S.A.	251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX ERJ 170-100 LR, -100 STD, -100 SE, -100 SU, -200 LR, -200 SU, -200 STD, and -200 LL; ERJ 190-100 STD, -100 LR, -100 ECJ, -100 IGW, -200 STD, -200 LR, and -200 IGW
2020-12-15		Bombardier, Inc.	BD-700-1A10 and BD-700-1A11
2020-13-08	R 2005-23-09	General Electric Company	CF6-80E1A1, -80E1A2, -80E1A3, -80E1A4, and -80E1A4/B
2020-14-04		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-A, Trent 1000-AE, Trent 1000-C, Trent 1000-CE, Trent 1000-D, Trent 1000-E, Trent 1000-G, and Trent 1000-H
2020-14-09		The Boeing Company	737-8 and 737-9
<b>Biweekly 2020-16</b>			
2020-14-03		The Boeing Company	737-300, -400, and -500 series
2020-14-05		Airbus SAS	A319-111, -112, -113, -114, -115, -131, -132, and -133
2020-14-08		Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, -171N; A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, -273N; A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX
2020-15-02		Gulfstream Aerospace LP	G280
2020-15-03	R 2016-07-13	GE Aviation Czech s.r.o.	M601D-11, M601E-11, M601E-11A, M601E-11AS, M601E-11S, and M601F
2020-15-04	R 2018-03-22	GE Aviation Czech s.r.o.	M601D-11, M601E-11, M601E-11A, M601E-11AS, M601E-11S, M601F, H75-100, H75-200, H80, H80-100, H80-200, H85-100, and H85-200
2020-15-07		Rolls-Royce Deutschland Ltd & Co KG	RB211-524G2-19, RB211-524G2-T-19, RB211-524G3-19, RB211-524G3-T-19, RB211-524H2-19, RB211-524H2-T-19, RB211-524H-36 and RB211-524H-T-36
2020-15-08		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-A, Trent 1000-A2, Trent 1000-AE, Trent 1000-AE2, Trent 1000-C, Trent 1000-C2, Trent 1000-CE, Trent 1000-CE2, Trent 1000-D, Trent 1000-D2, Trent 1000-E, Trent 1000-E2, Trent 1000-G, Trent 1000-G2, Trent 1000-H, Trent 1000-H2, Trent 1000-J2, Trent 1000-K2, and Trent 1000-L2
2020-15-09		Airbus SAS	A330-941
2020-15-10		Airbus SAS	A350-941
2020-15-12	R 2018-08-02	Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-A2, Trent 1000-AE2, Trent 1000-C2, Trent 1000-CE2, Trent 1000-D2, Trent 1000-E2, Trent 1000-G2, Trent 1000-H2, Trent 1000-J2, Trent 1000-K2, and Trent 1000-L2
2020-15-14	R 2015-13-06	The Boeing Company	747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series
2020-16-13		Rolls-Royce Corporation	AE 3007A, AE 3007A1, AE 3007A1/1, AE 3007A1/2, AE 3007A1/3, AE 3007A1E, AE 3007A1P, and AE 3007A3
2020-16-51	E	The Boeing Company	737-300, -400, -500, -600, -700, -700C, -800, -900, and 900ER series

### Biweekly 2020-17

2020-12-13	A 2016-17-15	Bombardier, Inc.	CL-600-2B19 (Regional Jet Series 100 & 440)
2020-12-14		Bombardier, Inc.	BD-700-1A10 and BD-700-1A11
2020-12-16		Airbus SAS	A320-214, -216, -231, -232, -233, -251N, -271N
2020-16-01		Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, -171N; A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, -273N; A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -252N, -253N, -271N, -272N, -251NX, -252NX, -253NX, -271NX, -272NX
2020-16-51		The Boeing Company	737-300, -400, -500, -600, -700, -700C, -800, -900, and -900ER series

## LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
--------	-------------	--------------	---------------

Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects

### Biweekly 2020-18

2020-15-20	R 2019-03-11	Airbus SAS	A350-941 and -1041
2020-15-21		Airbus SAS	A330-201, -202, -203, -223, and -243; A330-223F and -243F; A330-301, -302, -303, -321, -322, -323, -341, -342, and -343
2020-16-17		Rolls-Royce Deutschland Ltd & Co KG	Trent XWB-75, Trent XWB-79, Trent XWB-79B, and Trent XWB-84
2020-16-18		Airbus SAS	A310-203, -204, -221, -222, -304, -322, -324, and -325
2020-17-01		Airbus SAS	A319-115 and -153N; A320-214, -216, -232, -251N, -252N, -271N, and -273N; A321-211, -231, -251N, -253N, -271N, -272N, -251NX, -252NX, -253NX, and -271NX
2020-17-02		The Boeing Company	747-8 and -8F series; 787-8, -9, and -10
2020-17-03		Airbus SAS	A318-111, -112, -121, and -122; A319-111, -112, -113, -114, -115, -131, -132, and -133; A320-211, -212, -214, -216, -231, -232, and -233; A321-111, -112, -131, -211, -212, -213, -231, and -232
2020-17-04	R 2019-03-06	The Boeing Company	737-300, -400, and -500 series
2020-17-12		Dassault Aviation	MYSTERE-FALCON 900, FALCON 900EX, FALCON 2000, and FALCON 2000EX
2020-18-51	E	Sandia Attitude Indicator	Attitude Indicator

### Biweekly 2020-19

2020-17-13		The Boeing Company	787-8 and 787-9
2020-17-14		Dassault Aviation	Falcon 10
2020-17-16		Airbus SAS	A330-202, -203, -223, -243; A330-301, -321, -322, -323, -341, -342, -343; A340-211, -212, -213; and A340-311, -312, -313
2020-18-03		Airbus SAS	A350-941 and -1041
2020-18-04		Airbus SAS	A350-941 and -1041
2020-18-06		Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133; A320-211, -212, -214, -216, -231, -232, -233; and A321-111, -112, -131, -211, -212, -213, -231, -232
2020-18-07	R 2016-18-09	Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133; and A320-211, -212, -214, -216, -231, -232, -233
2020-18-51		Sandia Attitude Indicator	Attitude Indicator

### Biweekly 2020-20

2020-18-09		Honeywell International Inc.	ALF502L, ALF502L-2, ALF502L-2A, ALF502L-2C, ALF502L-3, ALF502R-3, ALF502R-3A, ALF502R-4, ALF502R-5, ALF502R-6, LF507-1F, and LF507-1H
2020-18-10		Airbus SAS	A319-151N, -153N; A320-251N, -252N, -253N; and A321-251N, -252N, -253N, -251NX, -252NX, -253NX
2020-18-12		The Boeing Company	777-200, 777-200LR, and 777-300 series
2020-18-13		The Boeing Company	737-600, -700, -700C, -800, -900, and -900ER series
2020-18-14		General Electric Company	GE90-110B1 and GE90-115B
2020-18-15		Airbus SAS	A350-941 and -1041
2020-19-03		Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133; A320-211, -212, -214, -216, -231, -232, -233; and A321-111, -112, -131, -211, -212, -213, -231, -232



**2020-18-09 Honeywell International Inc.:** Amendment 39-21230; Docket No. FAA-2020-0394; Project Identifier AD-2019-00141-E.

**(a) Effective Date**

This AD is effective October 21, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all Honeywell International Inc. (Honeywell) ALF502L, ALF502L-2, ALF502L-2A, ALF502L-2C, ALF502L-3, ALF502R-3, ALF502R-3A, ALF502R-4, ALF502R-5, ALF502R-6, LF507-1F, and LF507-1H model turbofan engines.

**(d) Subject**

Joint Aircraft System Component (JASC) Code 7200, Engine (Turbine/Turboprop); 7300, Engine Fuel and Control; and 7620, Engine Emergency Shutdown System.

**(e) Unsafe Condition**

This AD was prompted by a report of an engine experiencing an uncontained release of low-pressure turbine (LPT) blades. The FAA is issuing this AD to prevent failure of the LPT blades. The unsafe condition, if not addressed, could result in uncontained LPT blade release, damage to the engine, and loss of the aircraft.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

(1) Perform an initial visual inspection of the overspeed fuel solenoid valve assembly and fuel filter outlet in accordance with the Accomplishment Instructions, paragraphs 3.B.(1) to (3), of Honeywell Service Bulletin (SB) ALF/LF-72-1120, Revision 2, dated May 14, 2020 (“Honeywell SB ALF/LF-72-1120”), using the times, as applicable, in paragraphs (g)(1)(i), (ii), and (iii) of this AD.

(i) If, on the effective date of this AD, the fuel solenoid valve assembly has 1,500 or less engine cycles since last overhaul, perform the inspection before exceeding 3,000 engine cycles since last overhaul or within 5 years after the effective date of this AD, whichever occurs first.

(ii) If, on the effective date of this AD, the fuel solenoid valve assembly has greater than 1,500 but less than 3,000 engine cycles since last overhaul, perform the inspection before exceeding 3,500

engine cycles since last overhaul or within 5 years after the effective date of this AD, whichever occurs first.

(iii) If, on the effective date of this AD, the fuel solenoid valve assembly has 3,000 or more engine cycles since last overhaul, perform the inspection before exceeding 500 engine cycles or within 5 years after the effective date of this AD, whichever occurs first.

(2) Thereafter, repeat the visual inspection of the overspeed fuel solenoid valve assembly, fuel filter outlet, and adjacent fuel system tube assemblies at intervals not to exceed 3,000 engine cycles since the last visual inspection using the Accomplishment Instructions, paragraphs 3.B.(1) to (3), of Honeywell SB ALF/LF-72-1120.

(3) If, based on the visual inspection required by paragraph (g)(1) or (2) of this AD, an overspeed fuel solenoid valve assembly is rejected for visual coking or varnish residue, as depicted in the Accomplishment Instructions, paragraph 3.B.(3) of Honeywell SB ALF/LF-72-1120, before further flight:

(i) Remove and inspect the adjacent fuel system tube assemblies using the Accomplishment Instructions, paragraph 3.B.(3) of Honeywell SB ALF/LF-72-1120.

(ii) Overhaul the overspeed fuel solenoid valve assembly or replace it with a part eligible for installation using the Accomplishment Instructions, paragraphs 3.B.(5) to (8), of Honeywell SB ALF/LF-72-1120.

Note to paragraph (g)(3)(ii) of this AD: Valves may be serviced at any appropriately rated, FAA-approved repair facility.

(4) At the next engine shop visit after the effective date of this AD, and each shop visit thereafter, if the overspeed fuel solenoid valve assembly time since new or since last overhaul, whichever is less, exceeds 8,000 engine cycles or is unknown, overhaul the overspeed fuel solenoid valve assembly in accordance with the applicable Honeywell Temporary Revision (TR) for the engine, as defined in paragraph (h)(2) of this AD.

#### **(h) Definition**

(1) For the purpose of this AD, a “part eligible for installation” is an overspeed fuel solenoid valve assembly including, but not limited to, P/Ns 2-303-175-01, 2-303-175-02, or 2-303-901-01.

(2) For the purpose of this AD, the “applicable Honeywell TR” refers, depending on the affected engine model, to the following engine model TRs:

(i) Honeywell TR No. 72-1022, dated October 14, 2019, to Honeywell Turbofan Aircraft Engine Manual Report No. 286.1, Revision 27, dated August 27, 2004, for Honeywell Engine Manual ALF502R;

(ii) Honeywell TR No. 72-202, dated October 10, 2019, to Honeywell Turbofan Aircraft Engine Manual 507F.1, Revision 6, dated August 16, 2013, for Honeywell Engine Manual LF507-1F;

(iii) Honeywell TR No. 72-177, dated October 10, 2019, to Honeywell Turbofan Aircraft Engine Manual Report No. 507H.1, Revision 5, dated September 30, 1999, for Honeywell Engine Manual LF507-1H; or

(iv) Honeywell TR No. 72-57, dated October 29, 2019, to Honeywell Turbofan Engine Overhaul Manual 72-07-07, Revision 1, dated January 31, 2001, for Honeywell Overhaul Manual ALF502L.

#### **(i) Credit for Previous Actions**

You may take credit for the initial visual inspection, overhaul, and replacement required by paragraph (g)(1) to (3) of this AD if the inspection was performed using the Accomplishment Instructions, paragraphs 3.B.(1) to (3) and 3.B.(5) to (8), of Honeywell SB ALF/LF-72-1120, Revision 1, dated January 6, 2020, or paragraphs 3.B.(1) to (3) and 3.B.(6) of Revision 0, dated August 30, 2019.

**(j) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(k) Related Information**

For more information about this AD, contact Mark Matzke, Aerospace Engineer, Los Angeles ACO Branch, FAA, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5312; fax: 562-627-5210; email: mark.matzke@faa.gov.

**(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Honeywell International Inc. (Honeywell) Service Bulletin ALF/LF-72-1120, Revision 2, dated May 14, 2020.

(ii) Honeywell Temporary Revision (TR) No. 72-1022, dated October 14, 2019, to Honeywell Turbofan Aircraft Engine Manual Report No. 286.1, Revision 27, dated August 27, 2004, for Honeywell Engine Manual ALF502R.

(iii) Honeywell TR No. 72-202, dated October 10, 2019, to Honeywell Turbofan Aircraft Engine Manual 507F.1, Revision 6, dated August 16, 2013, for Honeywell Engine Manual LF507-1F.

(iv) Honeywell TR No. 72-177, dated October 10, 2019, to Honeywell Turbofan Aircraft Engine Manual Report No. 507H.1, Revision 5, dated September 30, 1999, for Honeywell Engine Manual LF507-1H.

(v) Honeywell TR No. 72-57, dated October 29, 2019, to Honeywell Turbofan Engine Overhaul Manual 72-07-07, Revision 1, dated January 31, 2001, for Honeywell Overhaul Manual ALF502L.

(3) For Honeywell service information identified in this AD, contact Honeywell International Inc., 111 S. 34th Street, Phoenix, AZ 85034-2802; phone: 800-601-3099; website: <https://aerospace.honeywell.com/en#/>.

(4) You may view this service information at FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call 781-238-7759.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 24, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-20374 Filed 9-15-20; 8:45 am]



**2020-18-10 Airbus SAS:** Amendment 39-21231; Docket No. FAA-2020-0787; Project Identifier MCAI-2020-01090-T.

**(a) Effective Date**

This AD becomes effective October 6, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all of the Airbus SAS airplanes, certificated in any category, specified in paragraphs (c)(1) through (3) of this AD.

- (1) Model A319-151N and -153N airplanes.
- (2) Model A320-251N, -252N, and -253N airplanes.
- (3) Model A321-251N, -252N, -253N, -251NX, -252NX, and -253NX airplanes.

**(d) Subject**

Air Transport Association (ATA) of America Code 28, Fuel.

**(e) Reason**

This AD was prompted by a report indicating that Kathon FP 1.5 biocide added to fuel and running through an airplane's engines can lead to engine performance degradation. The FAA is issuing this AD to address airplanes operated with fuel mixed with Kathon FP 1.5 biocide, which could result in reduced engine performance, resulting in reduced controllability of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2020-0176, dated August 5, 2020 ("EASA AD 2020-0176").

**(h) Exceptions to EASA AD 2020-0176**

(1) Where EASA AD 2020-0176 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2020-0176 does not apply to this AD.

### **(i) Special Flight Permit**

Special flight permits, as described in 14 CFR 21.197 and 21.199, are not allowed until the applicable actions required by paragraph (g) of this AD have been accomplished.

### **(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0176 that contains RC procedures and tests: Except as required by paragraph (j)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

### **(k) Related Information**

For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email Sanjay.Ralhan@faa.gov.

### **(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0176, dated August 5, 2020.

(ii) [Reserved]

(3) For information about EASA AD 2020-0176, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; Internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0787.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 25, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-20680 Filed 9-18-20; 8:45 am]



**2020-18-12 The Boeing Company:** Amendment 39-21233; Docket No. FAA-2016-6140; Product Identifier 2015-NM-059-AD.

**(a) Effective Date**

This AD is effective October 26, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 777-200, 777-200LR, and 777-300 series airplanes, certificated in any category, line numbers 1 through 561 inclusive, excluding airplanes identified in paragraphs (c)(1) through (3) of this AD.

(1) Airplanes on which the center tank consists only of the inboard structural box of the left and right wings (i.e., the wing center structural box is a dry bay and is not part of the fuel tank).

(2) Airplanes equipped with a flammability reduction means (FRM) approved by the FAA as compliant with the fuel tank flammability reduction (FTFR) requirements of 14 CFR 25.981(b) or 26.33(c)(1).

(3) Airplanes equipped with an ignition mitigation means (IMM) approved by the FAA as compliant with the FTFR requirements of 14 CFR 25.981(c) or 26.33(c)(2).

**(d) Subject**

Air Transport Association (ATA) of America Code 28, Fuel.

**(e) Unsafe Condition**

This AD was prompted by the FAA's analysis of the Model 777 fuel system reviews conducted by the manufacturer. The FAA is issuing this AD to prevent ignition sources inside the center fuel tank, which, in combination with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Modification**

Within 72 months after the effective date of this AD, modify the fuel quantity indicating system (FQIS) to prevent development of an ignition source inside the center fuel tank due to electrical fault

conditions, using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

#### **(h) Alternative Actions for Cargo Airplanes**

For airplanes used exclusively for cargo operations: As an alternative to the requirements of paragraph (g) of this AD, do the actions specified in paragraphs (h)(1) and (2) of this AD, using methods approved in accordance with the procedures specified in paragraph (i) of this AD. To exercise this alternative, operators must perform the first inspection required under paragraph (h)(1) of this AD within 6 months after the effective date of this AD. To exercise this alternative for airplanes returned to service after conversion of the airplane from a passenger configuration to an all-cargo configuration more than 6 months after the effective date of this AD, operators must perform the first inspection required under paragraph (h)(1) of this AD prior to further flight after the conversion.

(1) Within 6 months after the effective date of this AD, record the existing fault codes stored in the FQIS processor and before further flight thereafter do a BITE check (check of built-in test equipment) of the FQIS. If any nondispatchable fault code is recorded prior to the BITE check or as a result of the BITE check, before further flight, do all applicable repairs and repeat the BITE check until a successful test is performed with no nondispatchable faults found, using a method approved in accordance with the procedures specified in paragraph (i) of this AD. Repeat these actions thereafter at intervals not to exceed 750 flight hours. Modification as specified in paragraph (h)(2) of this AD does not terminate the repetitive BITE check requirement of this paragraph.

(2) Within 72 months after the effective date of this AD, modify the airplane by separating FQIS wiring that runs between the FQIS processor and the center tank wing spar penetrations, including any circuits that might pass through a main fuel tank, from other airplane wiring that is not intrinsically safe, using methods approved in accordance with the procedures specified in paragraph (i) of this AD.

#### **(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

#### **(j) Related Information**

For more information about this AD, contact Jon Regimbal, Aerospace Engineer, Propulsion Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3557; email: Jon.Regimbal@faa.gov.

**(k) Material Incorporated by Reference**

None.

Issued on August 26, 2020.

Lance T. Gant,  
Director, Compliance & Airworthiness Division, Aircraft Certification Service.  
[FR Doc. 2020-19584 Filed 9-18-20; 8:45 am]



**2020-18-13 The Boeing Company:** Amendment 39-21234; Docket No. FAA-2016-6139; Product Identifier 2015-NM-061-AD.

**(a) Effective Date**

This AD is effective October 29, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes, certificated in any category, excluding airplanes identified in paragraphs (c)(1) and (2) of this AD.

(1) Airplanes equipped with a flammability reduction means (FRM) approved by the FAA as compliant with the fuel tank flammability reduction (FTFR) requirements of 14 CFR 25.981(b) or 26.33(c)(1).

(2) Airplanes equipped with an ignition mitigation means (IMM) approved by the FAA as compliant with the FTFR requirements of 14 CFR 25.981(c) or 26.33(c)(2).

**(d) Subject**

Air Transport Association (ATA) of America Code 28, Fuel.

**(e) Unsafe Condition**

This AD was prompted by the FAA's analysis of the Model 737 fuel system reviews conducted by the manufacturer. The FAA is issuing this AD to prevent ignition sources inside the center fuel tank, which, in combination with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Modification**

Within 72 months after the effective date of this AD, modify the fuel quantity indicating system (FQIS) to prevent development of an ignition source inside the center fuel tank due to electrical fault conditions, using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(h) Alternative Actions for Cargo Airplanes**

For airplanes used exclusively for cargo operations: As an alternative to the requirements of paragraph (g) of this AD, do the actions specified in paragraphs (h)(1) and (2) of this AD, using methods approved in accordance with the procedures specified in paragraph (i) of this AD. To exercise this alternative, operators must perform the first inspection required under paragraph (h)(1) of this AD within 6 months after the effective date of this AD. To exercise this alternative for airplanes returned to service after conversion of the airplane from a passenger configuration to an all-cargo configuration more than 6 months after the effective date of this AD, operators must perform the first inspection required under paragraph (h)(1) of this AD prior to further flight after the conversion.

(1) Within 6 months after the effective date of this AD, record the existing fault codes stored in the FQIS processor and before further flight thereafter do a BITE check (check of built-in test equipment) of the FQIS. If any nondispatchable fault code is recorded prior to the BITE check or as a result of the BITE check, before further flight, do all applicable repairs and repeat the BITE check until a successful test is performed with no nondispatchable faults found, using a method approved in accordance with the procedures specified in paragraph (i) of this AD. Repeat these actions thereafter at intervals not to exceed 750 flight hours. Modification as specified in paragraph (h)(2) of this AD does not terminate the repetitive BITE check requirement of this paragraph.

(2) Within 72 months after the effective date of this AD, modify the airplane by separating FQIS wiring that runs between the FQIS processor and the center tank wing spar penetrations, including any circuits that might pass through a main fuel tank, from other airplane wiring that is not intrinsically safe, using methods approved in accordance with the procedures specified in paragraph (i) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

**(j) Related Information**

For more information about this AD, contact Jon Regimbal, Aerospace Engineer, Propulsion Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3557; email: Jon.Regimbal@faa.gov.

**(k) Material Incorporated by Reference**

None.

Issued on August 26, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19809 Filed 9-23-20; 8:45 am]



**2020-18-14 General Electric Company:** Amendment 39-21235; Docket No. FAA-2020-0494;  
Project Identifier AD-2020-00324-E.

**(a) Effective Date**

This AD is effective October 21, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all General Electric Company (GE) GE90-110B1 and GE90-115B model turbofan engines with a high-pressure turbine (HPT) rotor stage 2 disk, part number 2505M73P03, and with a serial number listed in Appendix–A, Table 1, of GE GE90-100 Service Bulletin (SB) 72-0838, dated January 31, 2020.

**(d) Subject**

Joint Aircraft System Component (JASC) Code 7250, Turbine Section.

**(e) Unsafe Condition**

This AD was prompted by a report from the manufacturer that a subsurface anomaly was found on a HPT rotor stage 2 disk. The FAA is issuing this AD to prevent failure of the HPT rotor stage 2 disk. The unsafe condition, if not addressed, could result in uncontained HPT rotor stage 2 disk release, damage to the engine, and damage to the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Action**

(1) At the next piece-part exposure after the effective date of this AD, perform an ultrasonic inspection (USI) of the HPT rotor stage 2 disk in accordance with the Accomplishment Instructions, paragraph 3.B.(1)(a), of GE GE90-100 SB 72-0838, dated January 31, 2020.

(2) If, during the USI required by paragraph (g)(1) of this AD, a rejectable indication is found, remove the HPT rotor stage 2 disk from service before further flight and replace it with a part eligible for installation.

**(h) Definition**

For the purpose of this AD, “piece-part exposure” is when the HPT rotor stage 2 disk is removed from the engine and completely disassembled.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. You may email your request to: ANE-AD-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(j) Related Information**

For more information about this AD, contact Stephen Elwin, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: 781-238-7236; fax: 781-238-7199; email: stephen.l.elwin@faa.gov.

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) General Electric Company (GE) GE90-100 Service Bulletin 72-0838, dated January 31, 2020.

(ii) [Reserved]

(3) For GE service information identified in this AD, contact General Electric Company, 1 Neumann Way, Cincinnati, OH 45215; phone: 513-552-3272; email: aviation.fleetsupport@ae.ge.com.

(4) You may view this service information at FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call 781-238-7759.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 26, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-20337 Filed 9-15-20; 8:45 am]



**2020-18-15 Airbus SAS:** Amendment 39-21236; Docket No. FAA-2020-0330; Product Identifier 2020-NM-031-AD.

**(a) Effective Date**

This AD is effective October 26, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Airbus SAS Model A350-941 and -1041 airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020-0028, dated February 14, 2020 (“EASA AD 2020-0028”).

**(d) Subject**

Air Transport Association (ATA) of America Code 78, Exhaust.

**(e) Reason**

This AD was prompted by a report indicating that when the number 2 engine thrust reverser (T/R) was opened, the right-hand T/R hinge nut located at position 4 was found detached; investigation revealed that certain nuts could have been installed with noncompliant locking features, or with locking features that could degrade quicker than anticipated. The FAA is issuing this AD to address this condition, which, if occurring on multiple hinge attachments, could lead to in-flight loss of a T/R, consequent structural damage to the airplane, and possible injury to persons on the ground.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020-0028.

**(h) Exceptions to EASA AD 2020-0028**

- (1) Where EASA AD 2020-0028 refers to its effective date, this AD requires using the effective date of this AD.
- (2) The “Remarks” section of EASA AD 2020-0028 does not apply to this AD.

### **(i) No Reporting Requirement**

Although the service information referenced in EASA AD 2020-0028 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

### **(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0028 that contains RC procedures and tests: Except as required by paragraph (j)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

### **(k) Related Information**

For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218; email [kathleen.arrigotti@faa.gov](mailto:kathleen.arrigotti@faa.gov).

### **(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0028, dated February 14, 2020.

(ii) [Reserved]

(3) For information about EASA 2020-0028, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material

at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0330.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 26, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-20675 Filed 9-18-20; 8:45 am]



**2020-19-03 Airbus SAS:** Amendment 39-21244; Docket No. FAA-2020-0328; Product Identifier 2020-NM-030-AD.

**(a) Effective Date**

This AD is effective October 27, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to the Airbus SAS airplanes specified in paragraphs (c)(1) through (4) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020-0019, dated February 5, 2020 (“EASA AD 2020-0019”).

- (1) Model A318-111, -112, -121, and -122 airplanes.
- (2) Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes.
- (3) Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes.
- (4) Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Reason**

This AD was prompted by reports of crack findings in and around the fastener holes of the central and lateral window frame upper junction; those cracks were found on fastener holes outside of the inspection area specified in a certain airworthiness limitation item (ALI) task. The FAA is issuing this AD to address such cracking, which could result in reduced structural integrity of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020-0019.

### **(h) Exceptions to EASA AD 2020-0019**

- (1) Where EASA AD 2020-0019 refers to its effective date, this AD requires using the effective date of this AD.
- (2) The “Remarks” section of EASA AD 2020-0019 does not apply to this AD.

### **(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

- (1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.
- (2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.
- (3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0019 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

### **(j) Related Information**

For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email sanjay.ralhan@faa.gov.

### **(k) Material Incorporated by Reference**

- (1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.
- (2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.
  - (i) European Union Aviation Safety Agency (EASA) AD 2020-0019, dated February 5, 2020.
  - (ii) [Reserved]
- (3) For information about EASA AD 2020-0019, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.
- (4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material

at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0328.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on September 1, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-20826 Filed 9-21-20; 8:45 am]