

**FEDERAL AVIATION ADMINISTRATION
AIRWORTHINESS DIRECTIVES**

LARGE AIRCRAFT

BIWEEKLY 2020-19

8/31/2020 - 9/13/2020



Federal Aviation Administration
Continued Operational Safety Policy Section, AIR-141
P.O. Box 25082
Oklahoma City, OK 73125-0460

CHANGE OF ADDRESS NOTICE

Any change of address regarding the biweekly service must include the mailing label from a recent issue or your name and address printed exactly as they appear on the mailing label (including the computer number above the address).

Please allow one month for an address change.

MAIL YOUR ADDRESS CHANGE TO:

Superintendent of Documents
Government Printing Office
Mail List Branch SSOM
Washington, DC 20402

Telephone: (202) 512-1806
Facsimile: (202) 512-2250

LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
Biweekly 2020-01			
2019-23-04		The Boeing Company	727, 727-100, 727C, 727-100C, 727-200, and 727-200F
2019-23-16		The Boeing Company	737-100, -200, -200C, -300, -400, and -500
2019-24-12		De Havilland Aircraft of Canada Limited	DHC-8-401 and -402
2019-24-13		Airbus SAS	A318-111, -112, -121, and -122, A319-111, -112, -113, -114, -115, -131, -132, and -133, A320-211, -212, -214, -216, -231, -232, and -233, A321-111, -112, -131, -211, -212, -213, -231, and -232
2019-24-14		328 Support Services GmbH	328-100
2019-24-15		The Boeing Company	737-900ER
2019-24-16	R 2017-16-08	Embraer S.A	ERJ 190-100 STD, -100 LR, -100 ECJ, and -100 IGW, ERJ 190-200 STD, -200 LR, and -200 IGW
2019-24-18		The Boeing Company	727, 727C, 727-100, 727-100C, 727-200, and 727-200F, 757-200, -200PF, -200CB, and -300, 767-200, -300, -300F, and -400ER
2019-25-13		Engine Alliance	GP7270 and GP7277
2019-25-17		The Boeing Company	737-600, -700, -700C, -800, -900, and -900ER
Biweekly 2020-02			
2019-22-07		Bombardier, Inc	CL-600-2B19 (Regional Jet Series 100 & 440), CL-600-2C10 (Regional Jet Series 700, 701 & 702), CL-600-2D15 (Regional Jet Series 705), Model CL-600-2D24 (Regional Jet Series 900), Model CL-600-2E25 (Regional Jet Series 1000)
2019-23-14		The Boeing Company	37-100, -200, -200C, -300, -400, and -500
2019-24-01		Airbus SAS	A318-111, -112, -121, and -122, A319-111, -112, -113, -114, -115, -131, -132, and -133, A320-211, -212, -214, -231, -232, and -233, A321-111, -112, -131, -211, -231, -212, -213, and -232, A330-201, -202, -203, -223, -223F, -243, and -243F, A340-211, -212, -213, -311, -312, -313, -541, and -642
2019-25-10		Fokker Services B.V	F28 Mark 0070 and 0100
2019-25-11		Viking Air Limited	CL-215-1A10, CL-215-6B11 (CL-215T Variant)
2019-25-12	R 2016-18-02	The Boeing Company	777-200 and -300ER
2019-25-14		The Boeing Company	777-300ER and 777F
2019-25-15		Fokker Services B.V	F28 Mark 0100
2019-25-16	R 2017-06-08	Embraer S.A	ERJ 170-100 LR, -100 STD, -100 SE, and -100 SU airplanes; and Model ERJ 170-200 LR, -200 SU, -200 STD, and -200 LL
2019-25-18		Bombardier, Inc	CL-600-2B19 (Regional Jet Series 100 & 440)
2019-25-19		Airbus SAS	A350-941
2020-01-11	R 2017-12-07	The Boeing Company	737-800, -900, and -900ER
2020-01-55	E	General Electric Company	GE90-110B1 and GE90-115B
Biweekly 2020-03			
2019-25-20		Lockheed Martin Corporation/Lockheed Martin Aeronautics Company	382, 382B, 382E, 382F, and 382G; C-130A, C-130B, C-130BL, C-130E, C-130H, C-130H-30, C-130J, C-130J-30, EC-130Q, HC-130H, KC-130H, NC-130B, NC-130, and WC-130H airplanes
2019-25-55		The Boeing Company	737-300, -400, and -700 series airplanes
2019-26-01		Airbus SAS	A350-941 and -1041 airplanes
2020-01-12	A 2017-16-12	Airbus SAS	A318, A319, A320, A321 airplanes
2020-01-13	R 2018-19-26	Dassault Aviation	MYSTERE-FALCON 200 airplanes
2020-01-14	A 2010-26-05	Airbus SAS	A300 B2-1A, B2-1C, B2K-3C, B2-203, B4-2C, B4-103, and B4-203 airplanes
2020-01-17		Airbus SAS	A318, A319, A320, A321 airplanes
2020-01-18	R 2006-11-11	The Boeing Company	757-200, -200PF, -200CB, and -300 series airplanes

LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
--------	-------------	--------------	---------------

Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects

Biweekly 2020-04

2019-26-10		Bombardier, Inc.	CL-600-2C10, -2D15, -2D25, -2E25 airplanes
2019-26-11		Airbus SAS	A319, A320, A321 airplanes
2020-01-10		Airbus SAS	A350-941 airplanes
2020-01-15		Airbus SAS	A300, A310 airplanes
2020-01-16	A 2014-25-52	Airbus SAS	A330, A340 airplanes
2020-01-55		General Electric Company	GE90-110B1 and GE90-115B model turbofan engines
2020-02-10		De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402 airplanes
2020-02-12	R 2017-15-04	The Boeing Company	787 series airplanes
2020-02-13	R 2019-03-14 A 2010-26-05	Dassault Aviation	FAN JET FALCON, FAN JET FALCON SERIES C, D, E, F, and G airplanes
2020-02-14		Airbus SAS	A350-941 and -1041 airplanes
2020-02-15		Bombardier, Inc.	BD-700-1A10, BD-700-1A11 airplanes
2020-02-16		The Boeing Company	737-200, -200C, -300, -400, and -500 series airplanes
2020-02-18		Gulfstream Aerospace Corporation	GVI, GVII-G500, and GVII-G600 airplanes
2020-02-19	R 2003-09-04 R1	Bombardier, Inc.	CL-600-2B19 airplanes
2020-02-20	R 2014-24-07	Airbus SAS	A318, A319, A320, A321 airplanes
2020-02-21	R 2014-03-12 R 2018-19-25 A 2010-26-05	Dassault Aviation	FALCON 2000 airplanes
2020-02-22		Airbus SAS	A300, A310 airplanes
2020-03-11		The Boeing Company	707-100 long body, -200, -100B long body, -100B short body, -300, -300B, -300C, and -400 series; and 720 and 720B series airplanes
2020-03-12		Airbus SAS	A350-941 and -1041 airplanes

Biweekly 2020-05

2020-01-18	COR	The Boeing Company	757-200, -200PF, -200CB, and -300 series airplanes
2020-02-19	R 2006-11-11 COR R 2003-09-04 R1	Bombardier, Inc.	CL-600-2B19 (Regional Jet series 100 & 440) airplanes
2020-03-10		The Boeing Company	737 series, except for 737-100, -200, -200C, -300, -400, and -500 series airplanes
2020-03-14		Airbus SAS	A350-941 and -1041 airplanes
2020-03-15		Airbus SAS	A321-211, -212, -213, -231, and -232 airplanes
2020-03-17	R 2015-24-04	Bombardier, Inc.	CL-600-2B19, -2C10, -2D15, -2D25, -2E25 airplanes
2020-03-18	R 2017-19-08	Airbus Defense and Space S.A.	C-212-CB, C-212-CC, C-212-CD, C-212-CE, and C-212-DF airplanes
2020-03-19	A 2010-26-05	Dassault Aviation	MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes
2020-03-20		The Boeing Company	MD-11, MD-11F, 717-200, 737-8, 737-9, 737-600, -700, -700C, -800, -900, and -900ER; 747-400 and 747-400F; 757-200, -200PF, -200CB, and -300; 767-200, -300, -300F, -400ER, and -2C; 777-200, -200LR, -300, and -300ER; 777F series airplanes
2020-03-21		Bombardier, Inc.	BD-700-1A10 and BD-700-1A11 airplanes
2020-03-22		The Boeing Company	787-8 airplanes
2020-03-23		Bombardier, Inc.	CL-600-2B19
2020-03-24	A 2010-26-05	Dassault Aviation	MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes
2020-04-01		Pratt & Whitney	PW1519G, PW1521G, PW1521GA, PW1524G, PW1525G, PW1521G-3, PW1524G-3, PW1525G-3, PW1919G, PW1921G, PW1922G, PW1923G, and PW1923G-A model turbofan engines

Biweekly 2020-06

2020-04-10	A 2011-03-10	Airbus SAS	A330 airplanes
2020-04-11		The Boeing Company	747-400 series airplanes
2020-04-12	R 2012-22-05 R 2018-19-03	Fokker Services B.V.	F28 Mark 0070 and 0100 airplanes
2020-04-18		Airbus SAS	A330-941 airplanes

LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
2020-05-01		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-AE3, Trent 1000-CE3, Trent 1000-D3, Trent 1000-G3, Trent 1000-H3, Trent 1000-J3, Trent 1000-K3, Trent 1000-L3, Trent 1000-M3, Trent 1000-N3, Trent 1000-P3, Trent 1000-Q3, and Trent 1000-R3 model turbofan engines
2020-05-10		Dassault Aviation	FALCON 7X airplanes
2020-05-12		Gulfstream Aerospace Corporation	GVII-G500 and GVII-G600 airplanes
2020-05-13		Airbus Canada Limited Partnership	BD-500-1A11 airplanes
2020-05-14		Airbus SAS	A320-214, -232, -271N; A321-231 airplanes
2020-05-18		Airbus SAS	A350-941 and -1041 airplanes
2020-06-01	R 2018-25-09 R 2019-12-01	CFM International, S.A.	LEAP-1B21, -1B23, -1B25, -1B27, -1B28, -1B28B1, -1B28B2, -1B28B3, -1B28B2C, -1B28BBJ1, and -1B28BBJ2 model turbofan engines
Biweekly 2020-07			
2020-04-19	R 2017-15-01	The Boeing Company	777-200, -200LR, -300, -300ER, and 777F series airplanes
2020-05-13		Airbus Canada Limited Partnership	BD-500-1A11 airplanes
2020-05-14		Airbus SAS	A320-214, -232, -271N; A321-231 airplanes
2020-05-15		Airbus SAS	A319-131, -132, -133; A320-231, -232, -233; and A321-131, -231, -232 airplanes
2020-05-16		Airbus SAS	A319-115; A320-214, -216, -232, -251N, -271N; and A321-211, -231, -251N, -251NX, -253N, -271N, -271NX, -272N airplanes
2020-05-17		Airbus SAS	A318-112, A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-216, A320-231, A320-232, A320-233, A320-251N, and A320-271N airplanes
2020-05-18		Airbus SAS	A350-941 and -1041 airplanes
2020-05-19		Airbus SAS	A319-112, -115, -132; and A320-214, -216, -232 -233 airplanes
2020-05-21		Yaborã Indústria Aeronáutica S.A.	ERJ 190-100 STD, -100 LR, -100 ECJ, -100 IGW, -200 STD, -200 LR, and -200 IGW airplanes
2020-05-22		Yaborã Indústria Aeronáutica S.A.	ERJ 170-100 LR, -100 STD, -100 SE, -100 SU; and ERJ 170-200 LR, -200 SU, -200 STD, -200 LL airplanes
2020-05-24	R 2010-26-01	The Boeing Company	777-200 series airplanes
2020-05-28	R 2019-11-08	International Aero Engines LLC	PW1133G-JM, PW1133GA-JM, PW1130G-JM, PW1129G-JM, PW1127G-JM, PW1127GA-JM, PW1127G1-JM, PW1124G-JM, PW1124G1-JM, and PW1122G-JM turbofan engines
2020-06-02		International Aero Engines LLC	PW1122G-JM, PW1124G1-JM, PW1124G-JM, PW1127GA-JM, PW1127G1-JM, PW1127G-JM, PW1133G-JM, PW1133GA-JM, PW1130G-JM, and PW1129G-JM turbofan engines
2020-06-14		The Boeing Company	787-8, 787-9, and 787-10 airplanes
2020-07-51	E	International Aero Engines AG	V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, and V2533-A5 turbofan engines
Biweekly 2020-08			
2020-04-15		The Boeing Company	757-200, -200PF, -200CB, and -300 series; 767-200, -300, and -300F series airplanes
2020-04-16		Yaborã Indústria Aeronáutica S.A.	ERJ 190-100 STD, -100 LR, -100 IGW, -200 STD, -200 LR, and -200 IGW airplanes
2020-04-17		Airbus SAS Model	A350-941 and -1041 airplanes
2020-04-20		De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402 airplanes
2020-04-22	R 2018-19-27 R 2014-16-12 A 2010-26-05	Dassault Aviation	FALCON 2000EX airplanes
2020-05-25		The Boeing Company	757-200, -200PF, -200CB, and -300 series airplanes
2020-05-26		The Boeing Company	787-8 airplanes

LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
2020-05-27 2020-06-10		Bombardier, Inc. Airbus SAS	BD-700-1A10 and BD-700-1A11 airplanes A318-111, -112, -121, and -122; A319-111, -112, -112, -113, -114, -115, -131, -132, and -133; A320-211, -212, -214, -216, -231, -232, and -233; A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes
2020-06-15 2020-06-16	R 2017-03-02	Fokker Services B.V. Rolls-Royce Deutschland Ltd. & Co. KG	F28 Mark 0100 airplanes RB211 Trent 768-60, 772-60, and 772B-60 turbofan engines
2020-06-17	R 2011-09-06	Airbus SAS	A330-223F and -243F; A330-201, -202, -203, -223, and -243; A330-301, -302, -303, -321, -322, -323, -341, -342, and -343; A330-941; A340-211, -212, and -213; A340-311, -312, and -313; A340-541 and -642 airplanes
2020-06-18		Airbus SAS	A318-111, -112, -121, and -122; A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N; A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N; A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX airplanes
2020-07-02		Pratt & Whitney	PW1519G, PW1521G, PW1521G-3, PW1521GA, PW1524G, PW1524G-3, PW1525G, and PW1525G-3 turbofan engines
2020-07-10 2020-08-01		Airbus SAS General Electric Company	A320-271N; A321-271N, -271NX, and -272N airplanes CF34-1A, CF34-3A, CF34-3A1, CF34-3A2, CF34-3B, and CF34-3B1 turbofan engines
Biweekly 2020-09			
2020-07-11		ATR–GIE Avions de Transport Regional	ATR42-200, -300, -320, and -500; ATR72-101, -102, -201, -202, -211, -212, and -212A
2020-07-12		ATR–GIE Avions de Transport Regional	ATR42-500
2020-07-13 2020-07-14		Bombardier, Inc The Boeing Company	BD-100-1A10 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series
2020-07-16	R 2016-16-09 R 2019-03-20 A 2014-16-23	Dassault Aviation	FALCON 7X
2020-07-17 2020-07-18	R 2017-05-12	Saab AB, Support and Services Airbus SAS	SAAB 2000 A318-112; A319-111, -112, -115, -132, and -133; A320-214, -216, -232, and -233; A321-211, -212, -213, -231, and -232
2020-07-19		ATR–GIE Avions de Transport Regional	ATR72-101, -102, -201, -202, -211, -212, and -212A
2020-07-20	R 2004-06-01 R 2009-06-09 A 2008-17-01 R1 A 2012-01-08	Support Services GmbH	328-100
2020-07-21		Yabora Industria Aeronautica S.A.	ERJ 170-100 LR, -100 STD, -100 SE, and -100 SU; ERJ 170-200 LR, -200 SU, -200 STD, and -200 LL; ERJ 190-100 STD, -100 LR, -100 ECJ, -100 IGW, -200 STD, -200 LR, and -200 IGW
2020-07-51		International Aero Engines AG	V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, and V2533-A5
2020-08-02		Thales AVS France SAS	Global Positioning System/Satellite Based Augmentation System receivers
2020-08-03	R 2008-22-24	Rolls-Royce Deutschland Ltd & Co KG	RB211-535E4-37, RB211-535E4-B-37, RB211-535E4-C-37, and RB-211-535E4-B-75
2020-08-04		International Aero Engines LLC	PW1133G-JM, PW1133GA-JM, PW1130G-JM, PW1129G-JM, PW1127G-JM, PW1127GA-JM, PW1127G1-JM, PW1124G-JM, PW1124G1-JM, and PW1122G-JM
2020-09-03		International Aero Engines AG	V2500-A1, V2522-A5, V2524-A5, V2525-D5, V2527-A5, V2527E-A5, V2527M-A5, V2528-D5, V2530-A5, V2531-E5, and V2533-A5

LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
--------	-------------	--------------	---------------

Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects

Biweekly 2020-10

2020-08-11		Yabora Industria Aeronautica S.A.	ERJ 190-300 and ERJ 190-400
2020-08-12		The Boeing Company	747-8 and 747-8F series
2020-08-13		Bombardier, Inc.	CL-600-2B19 (Regional Jet Series 100 & 440); CL-600-2C10 (Regional Jet Series 700, 701 & 702); CL-600-2D15 (Regional Jet Series 705), and CL-600-2D24 (Regional Jet Series 900)

Biweekly 2020-11

2020-06-19		The Boeing Company	727, 727C, 727-100, 727-100C, 727-200, and 727-200F series
2020-09-10	R 2018-25-04	Airbus Canada Limited Partnership	BD-500-1A10; BD-500-1A11
2020-09-11	R 2017-06-06 R 2019-12-10 A 2012-12-07	Fokker Services B.V.	F28 Mark 0070 and 0100
2020-09-12		De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402 series
2020-09-13	A 2009-01-06 R1 A 2012-01-08	328 Support Services GmbH	328-300
2020-09-14	R 2020-03-12	Airbus SAS	A350-941 and -1041
2020-09-16	R 2000-17-09 R 2008-04-19 R1 R 2015-26-09 A 2018-18-05	ATR-GIE Avions de Transport Regional	ATR42-200, -300, and -320
2020-10-04		General Electric Company	GE90-110B1 and GE90-115B
2020-10-05		Rockwell Collins, Inc.	Flight Management Systems
2020-10-10	R 2016-07-28	The Boeing Company	DC-9-81 (MD-81), DC-9-82 (MD-82), DC-9-83 (MD-83), and DC-9-87 (MD-87)
2020-11-04		Learjet Inc.	60

Biweekly 2020-12

2020-11-11		The Boeing Company	777-200, -200LR, -300, -300ER, and 777F series
2020-12-03		Rolls-Royce Deutschland Ltd & Co KG	Trent XWB-97

Biweekly 2020-13

2020-11-10		Bombardier, Inc.	BD-100-1A10
2020-11-13	R 2010-23-04	De Havilland Aircraft of Canada Limited	DHC-8-400, -401, and -402
2020-11-14		Bombardier, Inc.	BD-100-1A10
2020-12-01		Rolls-Royce Deutschland Ltd & Co KG	Trent XWB-75, XWB-79, XWB-79B, and XWB-84
2020-12-06		Gulfstream Aerospace Corporation	G-IV
2020-13-04	R 2017-09-06	General Electric Company	GENx-1B and GENx-2B

Biweekly 2020-14

2020-11-01		Gulfstream Aerospace Corporation	GVI
2020-11-12		The Boeing Company	737-8 and 737-9
2020-13-06		Pratt & Whitney Canada Corp.	PW150A
2020-13-07		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-D2, Trent 1000-J2, and Trent 1000-K2
2020-14-02		The Boeing Company	747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series

Biweekly 2020-15

2020-12-11		Airbus SAS	A319-111, -112, -113, -114, -115, -151N, -153N; A320-251N, -252N, -253N, -271N, -272N, -273N; A321-251N, -
------------	--	------------	--

LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
2020-12-12		Yabora Industria Aeronautica S.A.	251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX ERJ 170-100 LR, -100 STD, -100 SE, -100 SU, -200 LR, -200 SU, -200 STD, and -200 LL; ERJ 190-100 STD, -100 LR, -100 ECJ, -100 IGW, -200 STD, -200 LR, and -200 IGW
2020-12-15	R 2005-23-09	Bombardier, Inc.	BD-700-1A10 and BD-700-1A11
2020-13-08		General Electric Company	CF6-80E1A1, -80E1A2, -80E1A3, -80E1A4, and -80E1A4/B
2020-14-04		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-A, Trent 1000-AE, Trent 1000-C, Trent 1000-CE, Trent 1000-D, Trent 1000-E, Trent 1000-G, and Trent 1000-H
2020-14-09		The Boeing Company	737-8 and 737-9
Biweekly 2020-16			
2020-14-03		The Boeing Company	737-300, -400, and -500 series
2020-14-05		Airbus SAS	A319-111, -112, -113, -114, -115, -131, -132, and -133
2020-14-08		Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, -171N; A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, -273N; A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX
2020-15-02	R 2016-07-13 R 2018-03-22	Gulfstream Aerospace LP	G280
2020-15-03		GE Aviation Czech s.r.o.	M601D-11, M601E-11, M601E-11A, M601E-11AS, M601E-11S, and M601F
2020-15-04		GE Aviation Czech s.r.o.	M601D-11, M601E-11, M601E-11A, M601E-11AS, M601E-11S, M601F, H75-100, H75-200, H80, H80-100, H80-200, H85-100, and H85-200
2020-15-07		Rolls-Royce Deutschland Ltd & Co KG	RB211-524G2-19, RB211-524G2-T-19, RB211-524G3-19, RB211-524G3-T-19, RB211-524H2-19, RB211-524H2-T-19, RB211-524H-36 and RB211-524H-T-36
2020-15-08		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-A, Trent 1000-A2, Trent 1000-AE, Trent 1000-AE2, Trent 1000-C, Trent 1000-C2, Trent 1000-CE, Trent 1000-CE2, Trent 1000-D, Trent 1000-D2, Trent 1000-E, Trent 1000-E2, Trent 1000-G, Trent 1000-G2, Trent 1000-H, Trent 1000-H2, Trent 1000-J2, Trent 1000-K2, and Trent 1000-L2
2020-15-09	R 2018-08-02	Airbus SAS	A330-941
2020-15-10		Airbus SAS	A350-941
2020-15-12		Rolls-Royce Deutschland Ltd & Co KG	Trent 1000-A2, Trent 1000-AE2, Trent 1000-C2, Trent 1000-CE2, Trent 1000-D2, Trent 1000-E2, Trent 1000-G2, Trent 1000-H2, Trent 1000-J2, Trent 1000-K2, and Trent 1000-L2
2020-15-14	R 2015-13-06	The Boeing Company	747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series
2020-16-13		Rolls-Royce Corporation	AE 3007A, AE 3007A1, AE 3007A1/1, AE 3007A1/2, AE 3007A1/3, AE 3007A1E, AE 3007A1P, and AE 3007A3
2020-16-51	E	The Boeing Company	737-300, -400, -500, -600, -700, -700C, -800, -900, and 900ER series

Biweekly 2020-17

2020-12-13	A 2016-17-15	Bombardier, Inc.	CL-600-2B19 (Regional Jet Series 100 & 440)
2020-12-14		Bombardier, Inc.	BD-700-1A10 and BD-700-1A11
2020-12-16		Airbus SAS	A320-214, -216, -231, -232, -233, -251N, -271N
2020-16-01		Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, -171N; A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, -273N; A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -252N, -253N, -271N, -272N, -251NX, -252NX, -253NX, -271NX, -272NX
2020-16-51		The Boeing Company	737-300, -400, -500, -600, -700, -700C, -800, -900, and -900ER series

LARGE AIRCRAFT

AD No.	Information	Manufacturer	Applicability
Information Key: E – Emergency; COR – Correction; R – Replaces, A – Affects			
Biweekly 2020-18			
2020-15-20	R 2019-03-11	Airbus SAS	A350-941 and -1041
2020-15-21		Airbus SAS	A330-201, -202, -203, -223, and -243; A330-223F and -243F; A330-301, -302, -303, -321, -322, -323, -341, -342, and -343
2020-16-17		Rolls-Royce Deutschland Ltd & Co KG	Trent XWB-75, Trent XWB-79, Trent XWB-79B, and Trent XWB-84
2020-16-18		Airbus SAS	A310-203, -204, -221, -222, -304, -322, -324, and -325
2020-17-01		Airbus SAS	A319-115 and -153N; A320-214, -216, -232, -251N, -252N, -271N, and -273N; A321-211, -231, -251N, -253N, -271N, -272N, -251NX, -252NX, -253NX, and -271NX
2020-17-02		The Boeing Company	747-8 and -8F series; 787-8, -9, and -10
2020-17-03		Airbus SAS	A318-111, -112, -121, and -122; A319-111, -112, -113, -114, -115, -131, -132, and -133; A320-211, -212, -214, -216, -231, -232, and -233; A321-111, -112, -131, -211, -212, -213, -231, and -232
2020-17-04	R 2019-03-06	The Boeing Company	737-300, -400, and -500 series
2020-17-12		Dassault Aviation	MYSTERE-FALCON 900, FALCON 900EX, FALCON 2000, and FALCON 2000EX
2020-18-51	E	Sandia Attitude Indicator	Attitude Indicator
Biweekly 2020-19			
2020-17-13		The Boeing Company	787-8 and 787-9
2020-17-14		Dassault Aviation	Falcon 10
2020-17-16		Airbus SAS	A330-202, -203, -223, -243; A330-301, -321, -322, -323, -341, -342, -343; A340-211, -212, -213; and A340-311, -312, -313
2020-18-03		Airbus SAS	A350-941 and -1041
2020-18-04		Airbus SAS	A350-941 and -1041
2020-18-06		Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133; A320-211, -212, -214, -216, -231, -232, -233; and A321-111, -112, -131, -211, -212, -213, -231, -232
2020-18-07	R 2016-18-09	Airbus SAS	A318-111, -112, -121, -122; A319-111, -112, -113, -114, -115, -131, -132, -133; and A320-211, -212, -214, -216, -231, -232, -233
2020-18-51		Sandia Attitude Indicator	Attitude Indicator



2020-17-13 The Boeing Company: Amendment 39-21218; Docket No. FAA-2019-1070; Product Identifier 2019-NM-178-AD.

(a) Effective Date

This AD is effective October 8, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 787-8 and 787-9 airplanes, certificated in any category, as identified in Boeing Service Bulletin B787-81205-SB210108-00, Issue 002, dated October 15, 2019.

(d) Subject

Air Transport Association (ATA) of America Code 21, Air conditioning.

(e) Unsafe Condition

This AD was prompted by reports that the cabin air compressor (CAC) outlet check valve failed due to fatigue of the aluminum flappers, and exposed the Y-duct to temperatures above its design limit. The FAA is issuing this AD to address this condition, which could expose the flight deck and passenger cabin to smoke and fumes, and lead to reduced crew performance or produce passenger discomfort. Off-gassed compounds could cause respiratory distress and could cause serious injury for an individual with a compromised respiratory system.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified in paragraph (h) of this AD: At the applicable times specified in paragraph 5., "Compliance," of Boeing Service Bulletin B787-81205-SB210108-00, Issue 002, dated October 15, 2019, do all applicable actions identified as "RC" (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Service Bulletin B787-81205-SB210108-00, Issue 002, dated October 15, 2019.

(h) Exceptions to Service Information Specifications

Where Boeing Service Bulletin B787-81205-SB210108-00, Issue 002, dated October 15, 2019, uses the phrase “the Issue 002 date of this service bulletin,” this AD requires using “the effective date of this AD.”

(i) Parts Installation Prohibition

As of the effective date of this AD, no person may install a CAC outlet check valve, with a part number listed in paragraph 1.B, “Spares Affected” of Boeing Service Bulletin B787-81205-SB210108-00, Issue 002, dated October 15, 2019, or CAC outlet check valve P/N 7010105H01, on any airplane.

(j) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Service Bulletin B787-81205-SB210108-00, Issue 001, dated May 25, 2018.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (l) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (k)(4)(i) and (ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(l) Related Information

For more information about this AD, contact Scott Craig, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3566; email: Michael.S.Craig@faa.gov.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Service Bulletin B787-81205-SB210108-00, Issue 002, dated October 15, 2019.

(ii) [Reserved]

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 13, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19387 Filed 9-2-20; 8:45 am]



2020-17-14 Dassault Aviation: Amendment 39-21219; Docket No. FAA-2020-0448; Product Identifier 2020-NM-050-AD.

(a) Effective Date

This AD is effective October 8, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Dassault Aviation Model Falcon 10 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight Controls.

(e) Reason

This AD was prompted by a report of hydraulic fluid on the ground near the main landing gear brake assembly. The hydraulic leakage started in a cracked System #2 hydraulic pipe, with the crack likely due to chafing between two hydraulic pipes or between hydraulic pipes and structure. The FAA is issuing this AD to address chafed or cracked hydraulic pipes, which could lead to hydraulic fluid leakage near an ignition source and possibly result in an uncontained fire.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2020-0072, dated March 26, 2020 (“EASA AD 2020-0072”).

(h) Exceptions to EASA AD 2020-0072

(1) Where EASA AD 2020-0072 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2020-0072 does not apply to this AD.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Dassault Aviation's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(j) Related Information

For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3226; email tom.rodriguez@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0072, dated March 26, 2020.

(ii) [Reserved]

(3) For information about EASA AD 2020-0072, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; Internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0448.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 13, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19389 Filed 9-2-20; 8:45 am]



2020-17-16 Airbus SAS: Amendment 39-21221; Docket No. FAA-2020-0456; Product Identifier 2020-NM-053-AD.

(a) Effective Date

This AD is effective October 8, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model airplanes identified in paragraphs (c)(1) through (4) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020-0077, dated March 31, 2020 (“EASA AD 2020-0077”).

- (1) Model A330-202, -203, -223, and -243 airplanes.
- (2) Model A330-301, -321, -322, -323, -341, -342, and -343 airplanes.
- (3) Model A340-211, -212, and -213 airplanes.
- (4) Model A340-311, -312, and -313 airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight Controls.

(e) Reason

This AD was prompted by a report indicating that the allowable load limits on the vertical tail plane could be reached and possibly exceeded in cases of multiple rudder doublet inputs. The FAA is issuing this AD to address cases of multiple rudder doublet inputs, which could lead to excessive load on the vertical tail plane and a subsequent loss of control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020-0077.

(h) Exceptions to EASA AD 2020-0077

(1) Where EASA AD 2020-0077 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2020-0077 does not apply to this AD.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0077 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Related Information

For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email vladimir.ulyanov@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0077, dated March 31, 2020.

(ii) [Reserved]

(3) For information about EASA AD 2020-0077, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material

at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0456.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 14, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19390 Filed 9-2-20; 8:45 am]



2020-18-03 Airbus SAS: Amendment 39-21224; Docket No. FAA-2020-0338; Product Identifier 2020-NM-047-AD.

(a) Effective Date

This AD is effective October 8, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model A350-941 and -1041 airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020-0070, dated March 24, 2020 (“EASA AD 2020-0070”).

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

(e) Reason

This AD was prompted by the results of laboratory tests on non-rechargeable lithium batteries installed in certain emergency locator transmitters (ELTs), which highlighted a lack of protection against current injections of 28 volts direct current (DC) or 115 volts alternating current (AC) that could lead to thermal runaway and a battery fire. The FAA is issuing this AD to address local fires in non-rechargeable lithium batteries installed in ELTs, which could result in damage to the airplane and injury to occupants.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020-0070.

(h) Exceptions to EASA AD 2020-0070

- (1) Where EASA AD 2020-0070 refers to its effective date, this AD requires using the effective date of this AD.
- (2) The “Remarks” section of EASA AD 2020-0070 does not apply to this AD.

(3) Where the service information specified in EASA AD 2020-0070 specifies to use tape having part number ASNA51072503, this AD requires using any brightly colored 1-inch tape that meets the criteria specified in the ASNA5107 standard.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0070 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Related Information

For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218; email kathleen.arrigotti@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0070, dated March 24, 2020.

(ii) [Reserved]

(3) For information about EASA AD 2020-0070, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 19, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19402 Filed 9-2-20; 8:45 am]



2020-18-04 Airbus SAS: Amendment 39-21225; Docket No. FAA-2020-0783; Project Identifier MCAI-2020-01026-T.

(a) Effective Date

This AD becomes effective September 18, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Airbus SAS Model A350-941 and -1041 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight controls.

(e) Reason

This AD was prompted by a report of a slat system jam during landing. The FAA is issuing this AD to address a slat system jam during landing which could lead to a double shaft disconnection/rupture, potentially causing one or more slat surfaces to be no longer connected to either the slat wing tip brake or the slat power control unit (PCU), possibly resulting in reduced control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2020-0163R1, dated August 7, 2020 ("EASA AD 2020-0163R1").

(h) Exceptions to EASA AD 2020-0163

(1) Where EASA AD 2020-0163R1 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where EASA AD 2020-0163R1 refers to July 27, 2020, this AD requires using the effective date of this AD.

(3) Where EASA AD 2020-0163R1 requires certain actions to be done “before exceeding the thresholds specified in the AOT [alert operators transmission],” this AD requires those actions to be done “at the applicable compliance time specified in paragraph 4.2.3.1 of the AOT.”

(4) The “Remarks” section of EASA AD 2020-0163R1 does not apply to this AD.

(5) Paragraph (5) of EASA AD 2020-0163R1 specifies to report the results of the actions specified in paragraph (1) of EASA AD 2020-0163R1 to Airbus within a certain compliance time. For this AD, report the results at the applicable time specified in paragraph (h)(5)(i) or (ii) of this AD.

(i) If the action was done on or after the effective date of this AD: Submit the report within 30 days after the inspection.

(ii) If the action was done before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0163R1 that contains paragraphs that are labeled as RC: Except as required by paragraphs (h)(5) and (i)(2) of this AD, the instructions in RC paragraphs, including subparagraphs under an RC paragraph, must be done to comply with this AD; any paragraphs, including subparagraphs under that paragraph, that are not identified as RC are recommended. The instructions in paragraphs, including subparagraphs under that paragraph, not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the instructions identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to instructions identified as RC require approval of an AMOC.

(4) Paperwork Reduction Act Burden Statement: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. All responses to this collection of information are mandatory as required by this AD. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177-1524.

(j) Related Information

For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3218; email: kathleen.arrigotti@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0163R1, dated August 7, 2020.

(ii) [Reserved]

(3) For information about EASA AD 2020-0163R1, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADs@easa.europa.eu; internet: www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0783.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 20, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19386 Filed 9-2-20; 8:45 am]



2020-18-06 Airbus SAS: Amendment 39-21227; Docket No. FAA-2020-0332; Product Identifier 2020-NM-037-AD.

(a) Effective Date

This AD is effective October 8, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model airplanes specified in paragraphs (c)(1) through (4) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020-0037, dated February 27, 2020; corrected February 28, 2020 (“EASA AD 2020-0037”).

- (1) Model A318-111, -112, -121, and -122 airplanes.
- (2) Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes.
- (3) Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes.
- (4) Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Reason

This AD was prompted by a report that cracks were detected on the left- and right-hand sides of the first rivet hole of the frame (FR) 43 foot coupling during scheduled maintenance. The FAA is issuing this AD to address cracking in the foot coupling, which could affect the structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020-0037.

(h) Exceptions to EASA AD 2020-0037

- (1) Where EASA AD 2020-0037 refers to its effective date, this AD requires using the effective date of this AD.
- (2) The “Remarks” section of EASA AD 2020-0037 does not apply to this AD.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2020-0037 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

- (1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.
- (2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.
- (3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0037 that contains RC procedures and tests: Except as required by paragraph (j)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Related Information

For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email Sanjay.Ralhan@faa.gov.

(l) Material Incorporated by Reference

- (1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.
- (2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.
 - (i) European Union Aviation Safety Agency (EASA) AD 2020-0037, dated February 27, 2020; corrected February 28, 2020.
 - (ii) [Reserved]

(3) For information about EASA AD 2020-0037, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0332.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 20, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19401 Filed 9-2-20; 8:45 am]



FAA
Aviation Safety

AIRWORTHINESS DIRECTIVE

www.faa.gov/aircraft/safety/alerts/
www.gpoaccess.gov/fr/advanced.html

2020-18-07 Airbus SAS: Amendment 39-21228; Docket No. FAA-2020-0327; Product Identifier 2020-NM-033-AD.

(a) Effective Date

This AD is effective October 9, 2020.

(b) Affected ADs

This AD replaces AD 2016-18-09, Amendment 39-18639 (81 FR 61993, September 8, 2016) (“AD 2016-18-09”).

(c) Applicability

This AD applies to Airbus SAS Model airplanes specified in paragraphs (c)(1) through (3) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020-0030, dated February 18, 2020 (“EASA AD 2020-0030”).

- (1) Model A318-111, -112, -121, and -122 airplanes.
- (2) Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes.
- (3) Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Reason

This AD was prompted by reports of additional chafing of the forward fuselage underneath the fairing structure. Investigation revealed the cause as contact between the belly fairing nut plate and the fuselage. The FAA is issuing this AD to address damage to the fuselage skin, which could lead to crack initiation and propagation, possibly resulting in reduced structural integrity of the fuselage.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020-0030.

(h) Exceptions to EASA AD 2020-0030

(1) Where EASA AD 2020-0030 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2020-0030 does not apply to this AD.

(3) Where EASA AD 2020-0030 refers to the effective date of EASA AD 2014-0259, this AD requires using October 13, 2016 (the effective date of AD 2016-18-09).

(4) Where EASA AD 2020-0030 refers to doing actions “in accordance with the instructions of” the service information, for this AD, only use paragraph 3.C., “Procedure,” of the service information.

(5) Where paragraph (1) of EASA AD 2020-0030 requires accomplishing a detailed inspection of the affected area (external fuselage skin panels), for this AD, that inspection also includes inspecting previously repaired areas.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to 9-AVS-AIR-730-AMOC@faa.gov.

(i) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(ii) AMOCs approved previously for AD 2016-18-09 are approved as AMOCs for the corresponding provisions of EASA AD 2020-0030 that are required by paragraph (g) of this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Required for Compliance (RC): For any service information referenced in EASA AD 2020-0030 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Related Information

For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email sanjay.ralhan@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(3) The following service information was approved for IBR on October 9, 2020.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0030, dated February 18, 2020.

(ii) [Reserved]

(4) For information about EASA AD 2020-0030, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(5) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0327.

(6) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 21, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-19581 Filed 9-3-20; 8:45 am]



2020-18-51 Sandia Attitude Indicator: Amendment 39-21249; Docket No. FAA-2020-0794;
Project Identifier AD-2020-01232-Q.

(a) Effective Date

This AD is effective September 28, 2020 to all persons except those persons to whom it was made immediately effective by Emergency AD 2020-18-51, issued on August, 28, 2020, which contains the requirements of this AD.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Sandia attitude indicator (attitude indicator) part number 306171-10 and 306171-20. These attitude indicators may be marked as BendixKing Model KI-300 or Sandia Model SAI-340A. They may be installed on airplanes certificated in any category.

(d) Subject

Joint Airplane Service Component (JASC) Code: 3420, Attitude and Direction Data System.

(e) Unsafe Condition

This AD was prompted by reports of 54 failed attitude indicators, which produced erroneous attitude data to the pilot and autopilot, if equipped. The FAA is issuing this AD to prevent aeronautical decision-making based on erroneous attitude information, which may result in loss of control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) Before further flight, revise the limitations section of the existing Airplane Flight Manual for your airplane by inserting a copy of this AD or by making pen and ink changes to add:

(i) "Operation under Instrument Flight Rules or night Visual Flight Rules is prohibited."

(ii) "Coupling the autopilot with Sandia attitude indicator part number 306171-10 or 306171-20 is prohibited. These attitude indicators may be marked as BendixKing Model KI 300 or Sandia Model SAI 340A."

(2) The action required by paragraph (g)(1) of this AD may be performed by the owner/operator (pilot) holding at least a private pilot certificate and must be entered into the aircraft records showing

compliance with this AD in accordance with 14 CFR 43.9(a)(1) through (4) and 14 CFR 91.417(a)(2)(v). The record must be maintained as required by 14 CFR 91.417. This authority is not applicable to aircraft being operated under 14 CFR part 119.

(h) Special Flight Permits

Special flight permits are prohibited.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Fort Worth ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ASWFWACO@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Related Information

For further information about this AD, contact: John Felton, Aerospace Engineer, Fort Worth ACO Branch, Compliance & Airworthiness Division, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone 817-222-5171; email john.felton@faa.gov.

Issued on September 4, 2020.

Gaetano A. Sciortino,
Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-20049 Filed 9-10-20; 8:45 am]