

CHANGEDEPARTMENT OF TRANSPORTATION
FEDERAL AVIATION ADMINISTRATION

8010.2 CHG 2


1/8/79

Cancellation
Date: 4/1/79**SUBJ: FLIGHT STANDARDS SERVICE DIFFICULTY PROGRAM**

PURPOSE. This change reflects the discontinuance of AC 20-7, General Aviation Inspection Aids, and its replacement by AC 43-16, General Aviation Airworthiness Alerts. Minor editorial and updating changes have also been incorporated.

PAGE CONTROL CHART

Remove Pages	Dated	Insert Pages	Dated
iii - vi	2/22/78	iii iv v - vi	2/22/78
5 - 7 (and 8) 17 - 18	2/22/78 2/22/78	5 - 7 (and 8) 17 18	2/22/78
23 - 27 (and 28) 33 - 34	2/22/78 2/22/78	23 - 27 (and 28) 33 34	2/22/78
47 - 56 (thru 58) APPENDIX 1 1	2/22/78 2/22/78	47 - 56 (thru 58) APPENDIX 1 1	
APPENDIX 2 53 (and 54)	2/22/78	APPENDIX 2 53 (and 54) APPENDIX 5 1 - 5	

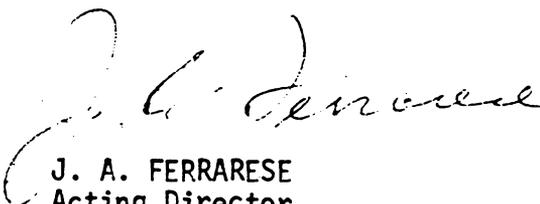

J. A. FERRARESE
Acting Director
Flight Standards Service

Distribution: A-WX(FS)-3; A-FFS-1,2,3,5,7,8(MAX); A-FIA-0(MAX); AFS-500(20 cys); AAC-952(80 cys) Initiated By: AFS-830

TABLE OF CONTENTS

	<u>Page No.</u>
CHAPTER 1. INTRODUCTION	1
SECTION 1. FLIGHT STANDARDS RESPONSIBILITY.	1
1. Purpose.	1
2. Distribution.	1
3. Cancellation.	1
4. Washington.	1
5. Field.	1
6. Airworthiness.	1
7. Engineering and Manufacturing.	2
8. Service Difficulty Board.	3
9. Safety Analysis Staff, AFS-80.	4
10. Safety Data Branch, AFS-580.	4
11. Regional Flight Standards.	4
12. Service Difficulty Coordinator.	5 (and 6)
13.-19. RESERVED.	5 (and 6)
CHAPTER 2. COLLECTION OF SERVICE DIFFICULTY INFORMATION	7 (and 8)
SECTION 1. GENERAL.	7 (and 8)
20. Authority.	7 (and 8)
21. Purpose.	7 (and 8)
22.-29. RESERVED.	7 (and 8)
SECTION 2. THE SERVICE DIFFICULTY REPORT (AIR CARRIER).	9
30. Responsibility.	9
31. Source of Information.	9
32. SDR Preparation.	9
33. Instructions for Completing FAA Form 8070-1.	11
34. Service Difficulty Reports, Processing Procedures.	18
35.-45. RESERVED.	20 (thru 22)
SECTION 3. THE MALFUNCTION OR DEFECT REPORT.	23
46. General.	23
47. Responsibility.	23
48. Sources of Information.	23
49. M or D's of Major Significance.	24
50. Recommendations.	24
51. Release of Failed Parts.	24
* 52. Instructions for Completing FAA Form 8010-4.	24
53. Distribution and Routing of FAA Form 8010-4.	26 *

	<u>Page No.</u>
SECTION 4. MANUFACTURERS' REPORTS OF FAILURES, MALFUNCTIONS, OR DEFECTS.	29
54. Authority.	29
55. Notification of Manufacturers.	29
56. Report Processing.	30
57. Public Availability.	31 (and 32)
58.-59. RESERVED.	31 (and 32)
CHAPTER 3. ANALYSIS OF SERVICE DIFFICULTY INFORMATION	33
SECTION 1. DUTIES AND RESPONSIBILITIES.	33
60. Safety Data Branch, AFS-580.	33
61. FAA District Office.	34
62. FAA Regional Office.	35
63. FAA Air Carrier/General Aviation Divisions, AFS-200/800.	36 (thru 38)
64.-69. RESERVED.	36 (thru 38)
SECTION 2. DIRECTED SAFETY INVESTIGATION (DSI).	39
70. General.	39
71. Implementation.	39
72. Summary - Directed Safety Investigation, RIS: FS 8330-9.	40
73. Directed Safety Investigation - Followup Review.	41 (thru 44)
74.-99. RESERVED.	41 (thru 44)
CHAPTER 4. SERVICE DIFFICULTY PROGRAM - DATA SYSTEM PRODUCTS AND SERVICES	45 (and 46)
SECTION 1. COMPUTER PRINTOUTS.	45 (and 46)
100. Available Printouts.	45 (and 46)
101. Scheduled Computer Printouts.	45 (and 46)
102. Special Computer Printouts.	45 (and 46)
103.-109. RESERVED.	45 (and 46)
SECTION 2. REPORT PREPARATION AND DISTRIBUTION.	47
110. Flight Standards Service Difficulty Reports, Daily Summary, RIS: FS 8070-2.	47
111. System Analysis and Summary Report, RIS: FS 8070-53.	47
112. Post Accident/Incident Report.	48 (thru 50)
113.-119. RESERVED.	48 (thru 50)
SECTION 3. REQUEST FOR INFORMATION.	51
120. General.	51
121. Service Difficulty Information.	51

	<u>Page No.</u>
122. Other Aeronautical Information.	51
123. Release of Service Difficulty Reports to the Public.	52 (thru 54)
124.-129. RESERVED.	52 (thru 54)
 CHAPTER 5. PRODUCTS OF THE SERVICE DIFFICULTY PROGRAM	 55
* SECTION 1. GENERAL AVIATION AIRWORTHINESS ALERTS -- DEVELOPMENT AND PREPARATION.	55 *
130. Purpose.	55
131. Selection of Items.	55
132. Regional Coordination.	56 (thru 58)
133.-149. RESERVED.	56 (thru 58)
 SECTION 2. MANUFACTURERS' SERVICE DOCUMENTS.	 59
150. Authority.	59
151. Purpose.	59
152. General.	59
153. Procedures.	59
 APPENDIX 1. REGIONAL SDR COORDINATORS AND SAFETY DATA BRANCH (1 page).	 1
 APPENDIX 2. AIR TRANSPORT ASSOCIATION OF AMERICA SPECIFICATION FOR MANUFACTURERS' TECHNICAL DATA (54 pages).	 1
 APPENDIX 3. FORMS AND REPORTS OF THE SERVICE DIFFICULTY PROGRAM (12 pages).	 1
Figure 1. Service Difficulty Report (Air Carrier), FAA Form 8070-1.	1
Figure 2. Service Difficulty Report (Reverse Side), FAA Form 8070-1.	2
Figure 3. Daily Summary of Service Difficulty Reports (Air Carrier), RIS: FS 8070-2.	3
* Figure 4. Malfunction or Defect Report, FAA Form 8010-4.	4
Figure 5. Malfunction or Defect Report (Reverse), FAA Form 8010-4 (General Aviation).	4 *
Figure 6. Daily Summary of Service Difficulty Reports (General Aviation).	5

	<u>Page No.</u>
122. Other Aeronautical Information.	51
123. Release of Service Difficulty Reports to the Public.	52 (thru 54)
124.-129. RESERVED.	52 (thru 54)
 CHAPTER 5. PRODUCTS OF THE SERVICE DIFFICULTY PROGRAM	 55
* SECTION 1. GENERAL AVIATION AIRWORTHINESS ALERTS -- DEVELOPMENT AND PREPARATION.	55 *
130. Purpose.	55
131. Selection of Items.	55
132. Regional Coordination.	56 (thru 58)
133.-149. RESERVED.	56 (thru 58)
 SECTION 2. MANUFACTURERS' SERVICE DOCUMENTS.	 59
150. Authority.	59
151. Purpose.	59
152. General.	59
153. Procedures.	59
 APPENDIX 1. REGIONAL SDR COORDINATORS AND SAFETY DATA BRANCH (1 page).	 1
 APPENDIX 2. AIR TRANSPORT ASSOCIATION OF AMERICA SPECIFICATION FOR MANUFACTURERS' TECHNICAL DATA (54 pages).	 1
 APPENDIX 3. FORMS AND REPORTS OF THE SERVICE DIFFICULTY PROGRAM (12 pages).	 1
Figure 1. Service Difficulty Report (Air Carrier), FAA Form 8070-1.	1
Figure 2. Service Difficulty Report (Reverse Side), FAA Form 8070-1.	2
Figure 3. Daily Summary of Service Difficulty Reports (Air Carrier), RIS: FS 8070-2.	3
* Figure 4. Malfunction or Defect Report, FAA Form 8010-4.	4
Figure 5. Malfunction or Defect Report (Reverse), FAA Form 8010-4 (General Aviation).	4 *
Figure 6. Daily Summary of Service Difficulty Reports (General Aviation).	5

12. SERVICE DIFFICULTY COORDINATOR.

a. Responsibilities. The Regional Service Difficulty Coordinator is responsible for:

(1) Serving as the focal point within the region for receiving service difficulty information and ensuring that information and documents received are disseminated to the appropriate branches for action.

(2) Performing staff functions in overseeing and assessing the Division's Service Difficulty Program management and accomplishments.

(3) Making recommendations to the Division Chief to revise national, regional, or division procedures.

(4) Effecting good communication and coordination with other branches within the division.

(5) Keeping the Division Chief advised on safety issues.

b. Specific Duties. The Regional Service Difficulty Coordinator is responsible for performing the following specific duties:

(1) Reporting, at the direction of the Division Chief, to the appropriate coordinator of the Service Difficulty Board on service difficulty items when corrective action CANNOT BE, or IS NOT, resolved between regions in a time period commensurate with safety implications.

(2) Coordinating Service Difficulty Reports (telephoned significant reports) from the field on products for which his region holds certificate management responsibility.

(3) Following up the status of actions taken in response to Maintenance Difficulty Records (telephoned significant reports) of service difficulties occurring in his region.

* (4) Submitting to AFS-580 a monthly report of items to be published in Advisory Circular 43-16, General Aviation Airworthiness Alerts. The region holding certificate management responsibility will make the report. *

(5) Ensuring that AFS-580 is informed of TC, PMA, TSOA, or STC address changes.

c. Regional Coordinators' names and locations (see Appendix 1).

13.-19. RESERVED.

CHAPTER 2. COLLECTION OF SERVICE DIFFICULTY INFORMATION

SECTION 1. GENERAL

20. AUTHORITY. Title VI of the Federal Aviation Act, Federal Aviation Regulations (FAR) Parts 21.3, 37.17, 121.703, 121.705, 123.27, 127.313, 127.315, 135.2, 135.57, 135.59, and 145.63.

21. PURPOSE. The service difficulty information provides the personnel of Flight Standards Service with reliability and airworthiness statistical data necessary for planning, directing, controlling, and evaluating certain assigned programs. This system also provides agency managers and inspectors with a means for measuring the effectiveness of the self-evaluation techniques being employed by certain segments of the civil aviation industry. There are three basic forms used in collecting service difficulty information: Service * Difficulty Reports (FAA Form 8070-1) for air carrier, Malfunction or Defect Reports (FAA Form 8010-4) for general aviation, and the Maintenance Difficulty Record (AC Form 8330-3) used to record telephonic reports. *

22.-29. RESERVED.

- E - Vibration/buffet: rough engine, clear air turbulence, flight controls.
- F - Flight controls affected: any malfunction affecting flight controllability.
- G - Multiple failure: multiple failure of like systems or units.
- H - Electrical power source loss exceeding 50 percent: alternators, buss, circuits.
- I - Flight attitude instrument malfunction.
- J - Warning indications.
- K - Fluid loss: any malfunction resulting in loss of fuel, oil, gas, etc.
- L - No test: the malfunction of a system being tested or the test circuit itself.
- M - Over temperature condition: not fire.
- N - False warning.
- O - Other.
- P - No warning indication.
- S - Other systems affected.
- T - Engine case punctured.
- X - Engine flame out
- Y - Engine stoppage in flight (except flame out) all engines.
- Z - Significant failure reports.

(7) Stage. Enter the stage of flight or ground operation the aircraft was engaged in when the reported failure, malfunction, or defect occurred or was observed.

<u>Code</u>	<u>Stage of Operation</u>	<u>Code</u>	<u>Stage of Operation</u>
IN -	Inspection/maintenance.	DE -	Descent.
TX -	Taxi/ground handling.	AP -	Approach.
TO -	Takeoff.	LD -	Landing.

<u>Code</u>	<u>Stage of Operation</u>	<u>Code</u>	<u>Stage of Operation</u>
CL -	Climb.	HO -	Hovering.
CR -	Cruise.		

(8) Stat. (Status). This is a coded entry to indicate if the report is "open" or "closed"; i.e., is additional information forthcoming? The entry will be made by AFS-580.

(9) Roll. The microfilm roll identification will be entered by AFS-580. All Service Difficulty Reports will be stored on microfilm the first and 16th day of each month.

(10) Frame. The microfilm frame identification of the individual report. The frame number will be assigned by AFS-580.

(11) Sys. (systems) (Sys. subsystems). Affected systems; enter the first three digits of the ATA subsystem which identifies those aircraft functions affected or whose capability has been degraded by the reported malfunction. Example: A windshield leaks water which enters the cockpit and affects electrical components. The affected systems reported may be VHF communications equipment with burned printed circuit boards. The systems reported would be VHF/UHF (232) and the printed circuit board (396). The fourth digit of the ATA subsystem code will not be entered in these blocks. AFS-580 will complete these entries.

(12) Text Summary. AFS-580 is responsible for condensing the text of the report into 115 characters for computer input.

NOTE: See Appendix 3, Figures 1 and 2, for a complete FAA Form 8070-1.

34. SERVICE DIFFICULTY REPORTS, PROCESSING PROCEDURES.

a. The District Office.

(1) The original and one legible copy of FAA Form 8070-1 (Service Difficulty Report) should be mailed to the Safety Data Branch, AFS-580, on the SAME DAY that the information is received in the district office. Prior to forwarding to AFS-580, ensure reports initiated by FAA inspectors and those received from industry include sufficient information to allow analysis.

(2) Do not fold FAA Form 8070-1 for mailing; folding will result in processing difficulties in the Safety Data Branch.

(3) Significant reports that warrant immediate notification of the FAA offices responsible for the failed products should be telephoned to the Maintenance Analysis Center, AFS-580 (see Appendix 1 for telephone numbers) and other interested regions (see paragraph 34a.(6)). The inspector will be provided, if appropriate, a telephone conference with the region holding the type certificate for the product. The information given during

SECTION 3. THE MALFUNCTION OR DEFECT REPORT

* FAA Form 8010-4 (RIS: FS 8330-11) (OMB 04-R0003)

46. GENERAL. The Malfunction or Defect (M or D) Report, FAA Form 8010-4, is *
to be used for collecting data on general aviation products. (See Appendix 3,
Figures 4 and 5.)

47. RESPONSIBILITY. FAA General Aviation/Flight Standards District Office
Inspectors are responsible for the completeness and accuracy of M or D
Reports submitted to their offices, and for submitting M or D Reports when
malfunctions or defects come to their attention through any other means.

48. SOURCES OF INFORMATION.

a. Certificated repair stations are required by FAR 145.63 to submit
reports of serious defects and recurring unairworthy conditions on a form
and in a manner prescribed by the Administrator. Field inspectors should
* supply and encourage their use of FAA Form 8010-4. *

* b. Air taxi operators are required by FAR 135.415 to report the occur-
rence of or detection of each failure, malfunction, or defect which has (or
may), in the operator's opinion, endangered the safe operation of the aircraft,
in addition to 16 specifically reportable items. Further, they are required
by FAR 135.417 to submit a report (form and manner not specified) for each
unscheduled change of aircraft en route, interruption to a flight, unscheduled
stop or diversion from a route caused by known or suspected mechanical diffi-
culty or malfunction. These will be reported, by field inspectors, on the
M or D Report (FAA Form 8010-4) or the Service Difficulty Report (FAA Form
8070-1) as appropriate when it is confirmed that the cause was a service
difficulty. *

c. Amateur-built aircraft, Experimental Aircraft Association (EAA).
GADO/FSDO inspectors are urged to encourage submission of M or D Reports
on this type aircraft and process them as any other M or D Report. The Great
Lakes Region has been designated as the controlling region for experimental
amateur-built aircraft of EAA members. Insofar as the Service Difficulty
Program is concerned, the EAA may function as though they were the
manufacturer of the aircraft (i.e., as a focal point through which corrective
action information is disseminated).

d. Field inspectors (all specialties) will report on the M or D Report
all service difficulties which come to their attention during accident/incident
investigations; surveillance of aircraft, agencies, and airmen; or which come
to their attention in any other manner.

* e. Reportable Service Difficulties. Whenever a system, component, or
part of an aircraft, powerplant, propeller, or appliance functions badly or
fails to operate in the normal or usual manner, it has malfunctioned and it
is reportable. Further, if a system, component, or part has a flaw or *

*imperfection which impairs or which may impair its future function, it is defective and should be reported. While at first sight it would appear this will generate numerous insignificant reports, the Service Difficulty Program is designed to detect trends and any report can be very constructive in evaluating design or maintenance reliability. *

49. M OR D's OF MAJOR SIGNIFICANCE. Inspectors becoming aware of service difficulties of a hazardous nature or of other major significance should call the MAC (see Appendix 1 for telephone numbers). The MAC will make a conference telephone call involving MAC, the inspector, the Regional Service Difficulty Coordinator and, when required, the technical specialist in the region most familiar with the affected item. In addition, the SDR coordinating region of occurrence will be informed of the telephonic report by receiving a copy of the record of the conference call prepared by the MAC specialist. This procedure is particularly applicable to items found during accident/incident investigations. M or D Reports must contain only factual information when initiated as a result of accident investigation and **SHOULD NOT INDICATE ACCIDENT CAUSE.** (Causal factors in accidents are determined by the National Transportation Safety Board.) If the inspector believes the service difficulty may have been a causal factor and wishes to lend importance to the report or give special alert notice, the information should be transmitted by phone to the Regional Service Difficulty Coordinator.

50. RECOMMENDATIONS. Recommendations for airworthiness directive action should be submitted through the appropriate regional organization with substantiation for further handling to the type certificate controlling region, with a copy to AFS-580 and AFS-800. Substantiation should be in the form of a description of the problem, drawings, photos if possible, information relative to the events of the malfunction, failure, or defect, and the inspector's recommendation concerning the corrective action to be taken.

51. RELEASE OF FAILED PARTS. When a failed part is obtained for forwarding with an M or D Report, the instructions as prescribed in Order 8020.11, Chapter 4, Section 2, paragraph 89, shall be followed.

* 52. INSTRUCTIONS FOR COMPLETING FAA FORM 8010-4. In some cases, it will be * difficult for the inspector to obtain all of the needed information. In these cases, the inspector will have to judge whether or not he has enough information for the report to be useful. Sometimes, just the number of happenings is an important factor in taking corrective action, while in others, complete details are needed. Complete details may be available for just one instance, and it is suspected that numerous others, for which data is lacking, were similar. Such circumstances shall be considered by the inspector when processing reports. The inspector should provide full information on reports vitally affecting safety, regardless of effort required, and should endeavor to provide sufficient data for analysis. Data to be entered in each block:

a. Block 1-Registration Number - Self-explanatory.

b. Block 2-Aircraft.

- (1) Column A. Make - name of manufacturer.
- (2) Column B. Model - as listed on FAA Type Certificate Data Sheets.
- (3) Column C. Serial Number - manufacturer assigned.

c. Block 3-Powerplant - Enter make, model, and serial number, under Columns A, B, and C, in same manner as for aircraft.

d. Block 4-Propeller - Enter make, model, and serial number in same manner as for aircraft and powerplant. Serial numbers are important for propeller problems; and inspectors should bear in mind that combinations of propellers, engines, and airplanes sometimes cause problems; therefore, requiring complete information in A, B, and C of 2, 3, and 4.

e. Block 5-Appliance/Component - Blocks A, B, C, and D are to be filled out for all reports along with 2, 3, and 4, A, B, and C. If an appliance or component report is being processed for a repair shop and it is not known what aircraft, powerplant, or propeller it was removed from, "component only" should be written across blocks 2, 3, 4, A, B, C. Some problems are brought about by a combination of an appliance/component and an aircraft, powerplant, or propeller. It is important in these cases that all information available be supplied. The above is especially applicable, but not limited to avionic equipment and instruments.

f. Block 6-Specific Part (of component) Causing Trouble. In all cases, the inspector should strive to furnish the information for A, B, C, E, F, and G. It will sometimes be difficult to complete E and F, and possibly B, but the inspector must decide if TIME is an important factor in solving the problem. If it is, he should make every effort to find the information. *

- (1) Block A - Name of specific part.
- (2) Block B - Part number of part assigned by the manufacturer.
- (3) Block C - Where on the part the defect is located.
- * (4) Block D - ATA Code. AFS-580 will code this, do not use. *
- (5) Block E - Total time on part in hours.
- (6) Block F - Time since overhaul on part in hours.
- (7) Block G - Cracked, corroded, broken off, etc.

g. Block 7A-Comments. The information to be entered here is perhaps the most important on the form. It must identify and describe the malfunction, failure, or defect and contain descriptive information concerning the part/component that caused the difficulty. It must enable someone not familiar with the problem to understand the problem and provide information to assist in the development of a fix. Data important to the particular problem; i.e., calendar dates, inspection findings, cycles, etc., that are not included in other blocks on the form should be included. If the malfunction, failure, or defect is the result of, or is related to, a Supplemental Type Certificate (STC), the STC number should be shown. This will enable AFS-580 to send the report to the proper controlling region.


(1) The submitter should use the space headed "7A Comments" first. If additional space is required, half of the reverse side should be used and a separate 8" by 10 1/2" sheet of paper attached if necessary. The submitter should be careful to leave enough space on the franked side of the form so that the pre-stamped General Aviation Flight Standards District Office address can be plainly deciphered.

(2) Submitted by - Except for air taxis, certificated repair stations, and FAA personnel, the identity of the submitter is not required. There have been reports that repair stations have suffered economic reprisals after submitting M or Ds on certain products; therefore, the M or D report has been modified to permit removal of identification data by "tear off." Identification will remain with the M or D report throughout FAA to facilitate followup investigation, if required. Identification will be removed by the region with product certificate management responsibility prior to making the forms or copies available to manufacturers. In cases where the submitter is reluctant, even with the above provisions, the FAA inspector will verify the report and identify himself as the submitter. In all cases, Blocks B, C, D, E, F, G, or H should be filled out.

h. Block 8 Date Submitted - Self-explanatory.

i. Block 9 Control Number - For use of AFS-580. (Do not use for * regional control numbers.)

53. DISTRIBUTION AND ROUTING OF FAA FORM 8010-4.

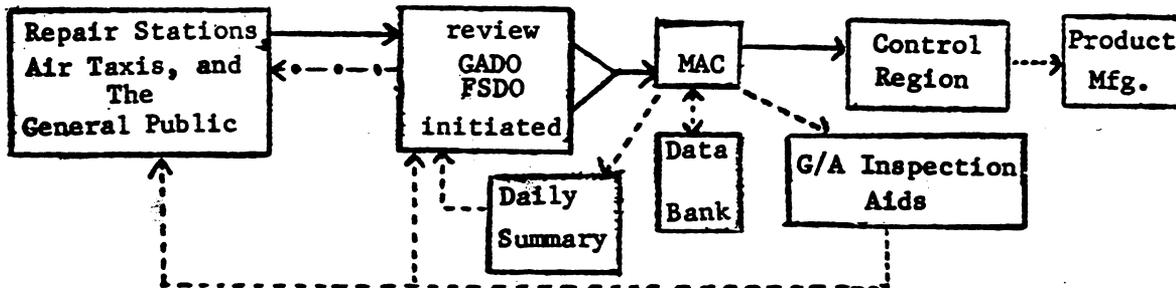

Self-addressed forms (indicated - - - - ->) are distributed to the general aviation public by GADO/FSDO personnel. The completed forms and those initiated by GADO/FSDO personnel (indicated _____>) are forwarded to MAC where pertinent data is extracted. The forms are then forwarded to the region in whose area the product reported on is manufactured (controlling region). The extracted data is entered into the data bank for further use and study.

* It also forms the basis for the Flight Standards Service Difficulty Reports and the General Aviation Airworthiness Alerts (AC 43-16). The publications are the media used to disseminate the information to GADO/FSDO personnel and the general aviation public (indicated - - - ->). *



CHAPTER 3. ANALYSIS OF SERVICE DIFFICULTY INFORMATION

SECTION 1. DUTIES AND RESPONSIBILITIES60. SAFETY DATA BRANCH, AFS-580.

a. Significant malfunctions, failures, and defects will be highlighted in the "Flight Standards Service Difficulty Reports, RIS: FS 8070-2," during the initial review of the Service Difficulty and Malfunction or Defect Reports. (See Appendix 3, Figure 6.) The specialist will use the following guidelines when selecting reports to be highlighted:

(1) Powerplants. Major internal components and parts thereof: noncontainment of parts, case burnthroughs and cracks, unwanted thrust reverser operation, and engine fires.

(2) Structure. Major primary structural parts (unusual cracks, corrosion, and deformation).

(3) Flight controls/control surfaces. Structural damage, unusual trim problem, vibration, flutter, cable failures, actuator failures, etc.

(4) Hydraulic power. Fluid/pressure loss, affecting controllability of the aircraft or landing gear actuation.

(5) Autoflight. Problems affecting controllability.

(6) Communications. Partial or complete loss of communication resulting in emergency action.

(7) Instrumentation. Multiple failure of like systems or equipment.

(8) Electrical power. Partial or complete loss of electrical power and fires resulting from electrical system malfunctions.

(9) Environmental Control Systems. Cabin pressurization or ventilation system failures which result in taking unscheduled or emergency corrective action.

b. AFS-580 will maintain the microfilm files of all service difficulty reports and control the microfilm distribution subject to disposal Order 1350.15, Records Organization, Transfer and Destruction Standards.

c. To detect adverse trends, AFS-580 will continually review all service difficulty information. When an adverse situation is noted, the specialist will prepare a System Analysis Summary Report. This report will be distributed to the responsible regional Engineering, Airworthiness Branches, or district office for action as necessary. The preparation and distribution of these reports are outlined in Chapter 4 of this Order.

d. When an AFS-580 specialist detects a problem area that requires emergency action, the specialist will notify, by telephone, the Service Difficulty Coordinator in the region having responsibility for the product, the principal inspector responsible for the maintenance or inspection system, and the appropriate Washington division.

61. FAA DISTRICT OFFICE. The following tasks will be accomplished by airworthiness/avionics/manufacturing inspectors in the review and followup of Service Difficulty and Malfunction or Defects Reports.

a. Review and provide follow-up action on all reported malfunctions, failures, and defects that are significant from a safety standpoint, on a daily basis.

b. Review the daily summary of Flight Standards Service Difficulty Reports, RIS: FS 8070-2, for problems that may be significant to the type aircraft or maintenance/inspection systems within their district. Particular attention should be given to those reports that are enclosed by a bold black border slashed with white. Such reports should be brought to the attention of the operator, repair station, or manufacturer as appropriate. The operator's inspection program should be reviewed to ensure sufficient inspection of the areas where the failure occurred. A solid black border indicates a significant item; however, the field inspector's action is discretionary. *

c. Review the System Analysis and Summary Reports (RIS: FS 8070-53) that are compiled by the Maintenance Analysis Center. Those systems which reflect failure trends should be investigated to determine whether the assigned operator, repair station, or manufacturer is experiencing similar problems and their course of action. Maintenance and inspection programs should be evaluated to assure appropriate inspection and time limitations are provided for the affected part of the system. Information developed from an investigation, triggered by an SAS report concerning significant failures of systems which could have an effect on the safety of the aircraft, should be furnished to the airworthiness and engineering elements of the controlling region, through channels. A copy of this report should be forwarded to the appropriate Washington division.

d. When contacting operators, airmen, and air agencies, regarding daily "Flight Standards Service Difficulty Report" and "System Analysis and Summary Report" items, assure that they are advised to report all subsequent occurrences to FAA.

e. Manufacturing inspectors should review the above reports to determine if there are any indicated deficiencies in their certificate holder's production or quality control systems. If need arises, the responsible EMDO/AEDO should investigate and take necessary corrective action in accordance with regional policy.

SECTION 2. REPORT PREPARATION AND DISTRIBUTION

- * 110. FLIGHT STANDARDS SERVICE DIFFICULTY REPORTS, RIS: FS 8070-2 (AIR CARRIER). This report is a daily compilation of all air carrier reports received on FAA Form 8070-1, Service Difficulties Report. (See Appendix 3, Figure 3.) They are disseminated to FAA Flight Standards personnel and certain segments of the aviation industry.
- a. Flight Standards Service Difficulty Reports, RIS: FS 8070-2 (General Aviation). This report is a daily compilation of selected significant reports for which segments of the industry and FAA Flight Standards personnel have immediate need. These reports will be selected by the Safety Data Branch specialist during initial review.
- b. Those reports, both general aviation and air carrier, that cite occurrences of a critical nature, will be highlighted by a bold black outline. Within the text block or directly beneath the report, a statement may be added to indicate that similar reports were received previously or on the same day. In some instances, a single report may be sufficient to warrant publication with the black outline. Certain items in general aviation reports (RIS: FS 8070-2) will be highlighted by a bold black outline slashed by white. This highlight is to alert FAA field personnel that actions specified in Chapter 3, Section 1, paragraph 6l.(b), are required. Actions taken as a result of the solid black outline are discretionary. *
- c. The Safety Data Branch, AFS-580, will produce the Flight Standards Service Difficulty Reports (RIS: FS 8070-2) and maintain a current distribution list of recipients in accordance with instructions of Washington divisions (AFS-200/800).
111. SYSTEM ANALYSIS AND SUMMARY REPORT, RIS: 8070-53. When analysis of Service Difficulty Program products indicates a specific problem and/or developing trends, the AFS-580 specialist will prepare a System Analysis Summary Report. The report will cover one subject failure but may include failures associated with or contributing to the primary subject failure. *
- a. The report should highlight the components and parts of the system causing the problem and include a brief history of reports received to establish the rate of problem development. Graphs or charts may be used for this purpose. *
- b. The report must be distributed to AFS-200, AFS-800, AFS-100, and to the Flight Standards Division of all regions. The region holding type certificate responsibility for the aircraft, product, or appliance will be responsible for positive action as that region deems appropriate. All regions will take appropriate actions related to inspection or maintenance programs which may be affected by the report. This will facilitate accurate distribution to those inspectors having certificate or surveillance responsibility for these inspections or maintenance programs, particular aircraft, or aircraft utilizing the system or part involved. *

* c. Problems discovered by field inspectors, as a result of surveillance emphasis generated by System Analysis and Summary Reports, will be reported on Malfunction or Defect Reports (FAA Form 8010-4) or Service Difficulty Reports (FAA Form 8070-1), as appropriate. Such reports assist in validating the trend indicated by the report and determining priority of corrective actions. *

d. If a trend or pattern continues after a System Analysis Summary Report has been forwarded to the office concerned, notification will be repeated in accordance with these procedures, unless the receiving office advises AFS-580 to withhold repetition.

112. POST ACCIDENT/INCIDENT REPORT. Following any accident or incident MAC will, when requested by Washington elements, immediately provide a report to the requesting office. Offices having a need for post accident/incident reports should request the reports from the appropriate Washington division through their regions. *

a. The report will include the following information for the most current one-year period.

(1) SDRs for the aircraft involved in the accident/incident.

(2) Operators' utilization for the aircraft type versus industry utilization.

(3) Operators' engine shutdown rate per 1,000 hours versus industry shutdown rate for the aircraft type.

(4) The number of engines shutdown by the operator versus industry shutdowns for the aircraft type.

(5) Any other information specifically requested.

* (6) A copy of the report will also be sent to the region with certificate responsibility. *

b. When the requesting office can identify the suspect system(s) and so requires, AFS-580 will research and provide copies of other relevant information, such as ADs, service bulletins, and inspection aids.

c. The FAA coordinator/investigator will be furnished a copy of this report at the scene of the accident/incident by the most expeditious means. The person making the report request must provide AFS-580 with the necessary address. When the accident/incident is being investigated by the NTSB, two copies of the report will be sent to the FAA coordinator (one copy for the NTSB investigator).

113.-119. RESERVED.

SECTION 3. REQUEST FOR INFORMATION

120. GENERAL. The Safety Data Branch, AFS-580, maintains the Service Difficulty Program data system, a technical library of most common aviation products, and has access to a great variety of aviation information.

121. SERVICE DIFFICULTY INFORMATION. Personnel of Flight Standards and NTSB may request information from the data system of this program. The request should indicate the type of information needed, the time period over which data should be searched, and the type of report desired (computer listing, summarized report, etc.). It is also important that the AFS-580 specialist know what use is to be made of the report. He can then assure the user of the best possible product. Every effort will be made to provide the report in a timeframe that will most benefit the user.

a. Persons requesting service difficulty data need not be concerned with computer sorting formats. They should state, in plain language, the kind of information that is desired; and the Maintenance Analysis Center specialist will select the computer format that will present the information in the most usable manner. For example, if a person wants information concerning failures of retract cylinders on a Beech 99 or Boeing 707, ask for it in that manner (e.g., how many retract cylinder failures reported within the last year?), rather than trying to specify the computer sort. This will provide only that information that is requested rather than the whole computer printout. This saves computer and user time and allows better utilization of the system resources.

b. The request should specify when the information is needed. In high priority situations, such as an accident or serious incident, the Maintenance * Analysis Center can provide the information within four hours. Depending upon the situation, other response times are available; e.g., 24 hours, 7 days, 14 days, or 30 days. The user is requested to apply good judgment relative * to priorities since computer programs must be interrupted in order to make the interrogation for requested data.

c. Technical data requested may be furnished via telephone, telecopier, special printout, or in summary form. (Printouts and summaries are mailed.) The MAC specialist will make every effort to provide the data to the individual within the specified response time.

122. OTHER AERONAUTICAL INFORMATION. Personnel of Flight Standards may request technical data other than service difficulty information to assist in identification of problem areas in aircraft and/or a particular fleet. When possible, AFS-580 will research Aeronautical Center data sources and furnish such information.

123. RELEASE OF SERVICE DIFFICULTY REPORTS TO THE PUBLIC. Service Difficulty Reports are releasable to the public under the provisions of the Freedom of Information Act (5 U.S.C. 552), as implemented by Part 7 of the Department of Transportation Regulations. Payment of fees will be in accordance with Section 7.38 of Title 49, Part 7, Department of Transportation Regulations.

- * a. Obtaining Service Difficulty Data. Service Difficulty Reports are available for retrieval for a period of 60 months following their receipt by AFS-580. All requests for copies of service difficulty information will be handled by the Safety Data Branch, AFS-580. Inquiries should be addressed to: *

Department of Transportation
Federal Aviation Administration
Flight Standards National Field Office
Safety Data Branch, AFS-580
P.O. Box 25082
Oklahoma City, Oklahoma 73125

- * b. Persons Requesting Service Difficulty Information should allow sufficient time between their request and their need for the information to provide adequate search and retrieval time. *

(1) Regional offices receiving direct requests for copies of Service Difficulty Reports should acknowledge those requests with a Correspondence Acknowledgement Card, FAA Form 1360-15. The request, along with a statement that FAA Form 1360-15 has been sent to the requester, will be forwarded to AFS-580.

(2) When copying of local region records is necessary, the copies should be made and accompany the request that is forwarded to AFS-580.

(3) AFS-580 will advise requester of the cost for services and respond to all requests.

(4) Requests directed to AFS-580. The Safety Data Branch will attempt to satisfy requests from the storage/retrieval system at the Aeronautical Center and will call upon the region in those cases where records/reports are only available locally.

124.-129. RESERVED.

CHAPTER 5. PRODUCTS OF THE SERVICE DIFFICULTY PROGRAM

SECTION 1. GENERAL AVIATION AIRWORTHINESS ALERTS --
DEVELOPMENT AND PREPARATION

- * 130. PURPOSE. The General Aviation Airworthiness Alerts provide a common *
communications channel through which the aviation community can economically
interchange service experience and thereby cooperate in the improvement
of aeronautical product durability, reliability, and safety.
- * 131. SELECTION OF ITEMS. Items suitable for publication as General
Aviation Airworthiness Alerts, AC 43-16, will be generated and developed by
personnel of AFS-580, by the region having type certificate responsibility,
by direction of the Service Difficulty Board or by the General Aviation
Division, AFS-800. The following procedures outline methods of selection: *
- a. Personnel of AFS-580, while analyzing readout data from the ADP
data bank, shall select safety information concerning noteworthy or unsafe
* conditions for publication in AC 43-16. Items selected should be of assistance
to maintenance and inspection personnel in performance of their duties.
The items selected should be in brief descriptive language and in a form
suitable for publication in order that time-consuming rewrite and editing
are not required. For example: *

BEECH	WINDSHIELD	Reports indicate the P/N50-380050-windshield wiper arms are cracking and breaking.
MODEL 99	WIPER	
or		
GRUMMAN	FIRE WARNING	A number of reports indicate shorts in the sensing elements and fire detector unit connector are attributable to the presence of moisture.
MODEL G-159	SYSTEM	

However, brevity should not compromise clarity. If time is not a factor, AFS-580 may coordinate the item with the type certificate holding region.

- b. Personnel of regions holding type certificate responsibility shall select items such as those described above. Items which do not concern a specific aeronautical product, or which may apply to several products, * may also be selected as "general information" items. Selected items will be forwarded monthly to the FAA, Flight Standards National Field Office, AFS-580, in a report, Summary Report of Safety Items Reviewed (RIS: FS 8330-2), containing a summary of the items selected for publication in AC 43-16. *

(1) The items should be in brief, descriptive language similar to the illustrations in paragraph 131a.

(2) From time-to-time, a region may determine that an item should receive expeditious treatment. These items should be marked "Preferred Handling." AFS-580 personnel will process these items accordingly.

c. On occasion, the Service Difficulty Board will determine the need * for items to be published in AC 43-16. In this event, the data will be transmitted to AFS-580 who will prepare it for publication in accordance with subparagraph a. of this paragraph. *

132. REGIONAL COORDINATION. Hazardous or alert type service difficulty items reported under the provisions of paragraph 110 of this order, which by their very nature have a strong possibility of regional corrective * action in process, will be withheld from the General Aviation Airworthiness Alerts (AC 43-16) publication for a period of 15 days after the telecon prescribed by paragraph 34a(3). During this time, it is the responsibility of the controlling region to either: *

a. Advise AFS-580 that the item should be published as an "Alert"; or

b. Advise AFS-580 that the corrective action instituted by the region precludes the necessity for such publication.

c. In the event that the region does not advise AFS-580 per a. or b. above, the item will be subject to processing by AFS-580 for publication.

133.-149. RESERVED.

APPENDIX 1. REGIONAL SDR COORDINATORS AND SAFETY DATA BRANCH

<u>Region</u>	<u>Coordinator & Alternate</u>	<u>Phone No.</u>	
AAL	Edward Allen (AAL-252)	FTS (8) 907/265-4252	
	alt. Dale L. Hanson (GADO-1)	FTS (8) 907/265-4657	
ACE	Glenn Martin (GADO-22)	FTS (8) 752-6523 Comm 316/943-3244	
* AFA	Donald J. Wisner (AEA-250.2)	FTS (8) 665-3300	
	alt. Lawrence Bottie (AEA-252.0)	Comm 212/995-3300	*
** AEU			
* AGL	Cornelius Biemond (AGL-217)	FTS (8) 384-9460 Comm 312/694-4500/9460	*
ANE	Robert A. Schilling (ANE-251)	FTS (8) 836-1326/1344	
	alt. Edward L. Park (ANE-256)	Comm 617/273-7326/7344	
ANW	Marion Shaw (ANW-254)	FTS (8) 396-2773 Comm 206/767-2773	
APC	Richard G. Teixeira (APC-240)	FTS (8) 808/546-8652	
	alt. Gary K. Nakagawa (APC-210)	FTS (8) 808/546-8650	
ASO	Richard L. Aaron (ASO-250)	FTS (8) 246-7411 Comm 404/763-7411	
* ARM	Charles R. Taylor (ARM-250)	FTS (8) 327-4188	
	alt. Roman B. Mueller (ARM-250)	Comm 303/837-4188	
ASW	John P. Donnelly (ASW-257)	FTS (8) 736-9543	
	alt. James R. Woehr (ASW-258)	Comm 817/624-4911	*
AWE	Jerry Presba (AWE-104)	FTS (8) 966-6351 Comm 213/536-6351	

**No coordinator assigned.

Safety Data Branch, AFS-580FTS (8) 732-4391
Comm 405/686-4391Maintenance Analysis CenterFTS (8) 732-4171
Comm 405/686-4171/4351* Data Review SectionFTS (8) 732-4351
Comm 405/686-2542

APPENDIX 2. SERVICE DIFFICULTY PROGRAM CODING SHEET

SERVICE DIFFICULTY PROGRAM CODING SHEET

NATURE OF CONDITION		STAGE		PRECAUTIONARY PROCEDURE				
System Sub Title	System Sub Title	System Sub Title	System Sub Title	System Sub Title	System Sub Title			
<p>A FLAME B SHORE C F.O.D. D INFLIGHT SEPARATION E VIBRATION/WAFFLE F FLT CONT EFFECTED G MULTIPLE FAILURE H ELECT. POWER LOSS-50% I FLT. ATTITUDE INST. J WARNING INDICATION K FLUID LOSS</p> <p>NOTE: ENTER ONE TO THREE CODES IN WHATIVER ORDER MOST REQUIRES ALL CONDITIONS ORIENTED.</p>	<p>L NO TEST M OVER TEMP N FALSE WARNING O OTHER P NO WARNING INDICATION Q AFFECTED SYSTEMS R ENGINE CASE PENETRATION S ENGINE FLAMEOUT T ENGINE STOPPAGE U WARNING INDICATION V REPORT</p> <p>NOTE: ENTER STAGE OF FLIGHT OR GROUND OPERATIONS WHEN OCCURRED OR WAS OBSERVED.</p>	<p>DE DISCENT AP APPROACH LD LANDING HO HOVERING UK UNKNOWN</p> <p>NOTE: ENTER ONE TO FOUR CODES IN WHATIVER ORDER MOST REQUIRES ALL STAGES OF THE PRECAUTIONARY PROCEDURE.</p>	<p>A UNCRCHED LANDING B EMER. DESCENT C ABORTED TAKEOFF D RETURN TO BLOCK E ENGINE SHUTDOWN F ACTIVATE FIRE EXT.</p> <p>G MANUAL OY MASK H DEACTIVATE SYST./CIRCUITS I INFLIGHT DEPRESSURE J QUAY FUEL K HIGH L ABORTED APPROACH O OTHER</p>	<p>31 AIR CONDITIONING 00 General 10 Ditch/Bailout 20 Descent/Approach 30 Descent/Approach 40 Descent/Approach 50 Descent/Approach 60 Descent/Approach 70 Descent/Approach 80 Descent/Approach 90 Descent/Approach</p> <p>32 LANDING GEAR 00 General 10 Gear Collapse 20 Gear Collapse 30 Gear Collapse 40 Gear Collapse 50 Gear Collapse 60 Gear Collapse 70 Gear Collapse 80 Gear Collapse 90 Gear Collapse</p> <p>33 LIGHTS 00 General 10 Landing Lights 20 Landing Lights 30 Landing Lights 40 Landing Lights 50 Landing Lights 60 Landing Lights 70 Landing Lights 80 Landing Lights 90 Landing Lights</p> <p>34 FIRE PROTECTION 00 General 10 Fire Detection 20 Fire Detection 30 Fire Detection 40 Fire Detection 50 Fire Detection 60 Fire Detection 70 Fire Detection 80 Fire Detection 90 Fire Detection</p> <p>35 FLIGHT CONTROLS 00 General 10 Stick/Control 20 Stick/Control 30 Stick/Control 40 Stick/Control 50 Stick/Control 60 Stick/Control 70 Stick/Control 80 Stick/Control 90 Stick/Control</p> <p>36 AUTO FLIGHT 00 General 10 Auto Pilot 20 Auto Pilot 30 Auto Pilot 40 Auto Pilot 50 Auto Pilot 60 Auto Pilot 70 Auto Pilot 80 Auto Pilot 90 Auto Pilot</p> <p>37 COMMUNICATIONS 00 General 10 Radio 20 Radio 30 Radio 40 Radio 50 Radio 60 Radio 70 Radio 80 Radio 90 Radio</p> <p>38 FUEL 00 General 10 Fuel System 20 Fuel System 30 Fuel System 40 Fuel System 50 Fuel System 60 Fuel System 70 Fuel System 80 Fuel System 90 Fuel System</p> <p>39 HYDRAULIC POWER 00 General 10 Hydraulic System 20 Hydraulic System 30 Hydraulic System 40 Hydraulic System 50 Hydraulic System 60 Hydraulic System 70 Hydraulic System 80 Hydraulic System 90 Hydraulic System</p> <p>40 ICE AND RAIN PROTECTION 00 General 10 Ice Detection 20 Ice Detection 30 Ice Detection 40 Ice Detection 50 Ice Detection 60 Ice Detection 70 Ice Detection 80 Ice Detection 90 Ice Detection</p> <p>41 ELECTRICAL POWER 00 General 10 Electrical System 20 Electrical System 30 Electrical System 40 Electrical System 50 Electrical System 60 Electrical System 70 Electrical System 80 Electrical System 90 Electrical System</p> <p>42 EQUIPMENT/FUNCTIONS 00 General 10 Equipment 20 Equipment 30 Equipment 40 Equipment 50 Equipment 60 Equipment 70 Equipment 80 Equipment 90 Equipment</p>	<p>39 WATER/WASTE 00 General 10 Waste 20 Waste 30 Waste 40 Waste 50 Waste 60 Waste 70 Waste 80 Waste 90 Waste</p> <p>40 ELECTRICAL/ELECTRONIC PANELS & MULTIFUNCTION COMPONENTS 00 General 10 Electrical/Electronic 20 Electrical/Electronic 30 Electrical/Electronic 40 Electrical/Electronic 50 Electrical/Electronic 60 Electrical/Electronic 70 Electrical/Electronic 80 Electrical/Electronic 90 Electrical/Electronic</p> <p>41 AIRBORNE AUXILIARY POWER 00 General 10 Power Plant 20 Power Plant 30 Power Plant 40 Power Plant 50 Power Plant 60 Power Plant 70 Power Plant 80 Power Plant 90 Power Plant</p> <p>42 NAVIGATION 00 General 10 Navigation 20 Navigation 30 Navigation 40 Navigation 50 Navigation 60 Navigation 70 Navigation 80 Navigation 90 Navigation</p> <p>43 OXYGEN 00 General 10 Oxygen System 20 Oxygen System 30 Oxygen System 40 Oxygen System 50 Oxygen System 60 Oxygen System 70 Oxygen System 80 Oxygen System 90 Oxygen System</p> <p>44 STRUCTURES 00 General 10 Structure 20 Structure 30 Structure 40 Structure 50 Structure 60 Structure 70 Structure 80 Structure 90 Structure</p> <p>45 DOORS 00 General 10 Door 20 Door 30 Door 40 Door 50 Door 60 Door 70 Door 80 Door 90 Door</p> <p>46 PNEUMATIC 00 General 10 Pneumatic System 20 Pneumatic System 30 Pneumatic System 40 Pneumatic System 50 Pneumatic System 60 Pneumatic System 70 Pneumatic System 80 Pneumatic System 90 Pneumatic System</p> <p>47 VACUUM/PRESSURE 00 General 10 Vacuum/Pressure 20 Vacuum/Pressure 30 Vacuum/Pressure 40 Vacuum/Pressure 50 Vacuum/Pressure 60 Vacuum/Pressure 70 Vacuum/Pressure 80 Vacuum/Pressure 90 Vacuum/Pressure</p> <p>48 INDICATING/RECORDING SYSTEMS 00 General 10 Indicating/Recording 20 Indicating/Recording 30 Indicating/Recording 40 Indicating/Recording 50 Indicating/Recording 60 Indicating/Recording 70 Indicating/Recording 80 Indicating/Recording 90 Indicating/Recording</p>	<p>34 WHEELS/PROPS 00 General 10 Wheel/Prop 20 Wheel/Prop 30 Wheel/Prop 40 Wheel/Prop 50 Wheel/Prop 60 Wheel/Prop 70 Wheel/Prop 80 Wheel/Prop 90 Wheel/Prop</p> <p>35 STAINLESS 00 General 10 Stainless Steel 20 Stainless Steel 30 Stainless Steel 40 Stainless Steel 50 Stainless Steel 60 Stainless Steel 70 Stainless Steel 80 Stainless Steel 90 Stainless Steel</p> <p>36 WINDOWS 00 General 10 Window 20 Window 30 Window 40 Window 50 Window 60 Window 70 Window 80 Window 90 Window</p> <p>37 WFOG 00 General 10 WFOG 20 WFOG 30 WFOG 40 WFOG 50 WFOG 60 WFOG 70 WFOG 80 WFOG 90 WFOG</p> <p>38 PROPELLERS 00 General 10 Propeller 20 Propeller 30 Propeller 40 Propeller 50 Propeller 60 Propeller 70 Propeller 80 Propeller 90 Propeller</p> <p>39 FUEL 00 General 10 Fuel System 20 Fuel System 30 Fuel System 40 Fuel System 50 Fuel System 60 Fuel System 70 Fuel System 80 Fuel System 90 Fuel System</p> <p>40 ENGINE RECROCKING 00 General 10 Engine Recocking 20 Engine Recocking 30 Engine Recocking 40 Engine Recocking 50 Engine Recocking 60 Engine Recocking 70 Engine Recocking 80 Engine Recocking 90 Engine Recocking</p> <p>41 ENGINE RECROCKING (RHO) 00 General 10 Engine Recocking 20 Engine Recocking 30 Engine Recocking 40 Engine Recocking 50 Engine Recocking 60 Engine Recocking 70 Engine Recocking 80 Engine Recocking 90 Engine Recocking</p>	<p>71 PORTERLANDI 00 General 10 Portland Cement 20 Portland Cement 30 Portland Cement 40 Portland Cement 50 Portland Cement 60 Portland Cement 70 Portland Cement 80 Portland Cement 90 Portland Cement</p> <p>72 (T) TURBINE/TURBOPROP 00 General 10 Turbine/Turbo Prop 20 Turbine/Turbo Prop 30 Turbine/Turbo Prop 40 Turbine/Turbo Prop 50 Turbine/Turbo Prop 60 Turbine/Turbo Prop 70 Turbine/Turbo Prop 80 Turbine/Turbo Prop 90 Turbine/Turbo Prop</p> <p>73 ENGINE RECROCKING 00 General 10 Engine Recocking 20 Engine Recocking 30 Engine Recocking 40 Engine Recocking 50 Engine Recocking 60 Engine Recocking 70 Engine Recocking 80 Engine Recocking 90 Engine Recocking</p> <p>74 ENGINE RECROCKING (RHO) 00 General 10 Engine Recocking 20 Engine Recocking 30 Engine Recocking 40 Engine Recocking 50 Engine Recocking 60 Engine Recocking 70 Engine Recocking 80 Engine Recocking 90 Engine Recocking</p>	<p>76 ENGINE CONTROLS 00 General 10 Engine Control 20 Engine Control 30 Engine Control 40 Engine Control 50 Engine Control 60 Engine Control 70 Engine Control 80 Engine Control 90 Engine Control</p> <p>77 ENGINE PICKETING 00 General 10 Engine Picketing 20 Engine Picketing 30 Engine Picketing 40 Engine Picketing 50 Engine Picketing 60 Engine Picketing 70 Engine Picketing 80 Engine Picketing 90 Engine Picketing</p> <p>78 ENGINE EXHAUST 00 General 10 Engine Exhaust 20 Engine Exhaust 30 Engine Exhaust 40 Engine Exhaust 50 Engine Exhaust 60 Engine Exhaust 70 Engine Exhaust 80 Engine Exhaust 90 Engine Exhaust</p> <p>79 ENGINE OIL 00 General 10 Engine Oil 20 Engine Oil 30 Engine Oil 40 Engine Oil 50 Engine Oil 60 Engine Oil 70 Engine Oil 80 Engine Oil 90 Engine Oil</p> <p>80 TURBINE RECROCKING (RHO) 00 General 10 Turbine Recocking 20 Turbine Recocking 30 Turbine Recocking 40 Turbine Recocking 50 Turbine Recocking 60 Turbine Recocking 70 Turbine Recocking 80 Turbine Recocking 90 Turbine Recocking</p>

APPENDIX 2. SERVICE DIFFICULTY PROGRAM CODING SHEET

SERVICE DIFFICULTY PROGRAM CODING SHEET

NATURE OF CONDITION		STAGE		PRECAUTIONARY PROCEDURE	
System Sub Title					
<p>A FLAME</p> <p>B SHORE</p> <p>C F.O.D.</p> <p>D INFLIGHT SEPARATION</p> <p>E VIBRATION/WAFFLE</p> <p>F FLT CONT EFFECTED</p> <p>G MULTIPLE FAILURE</p> <p>H ELECT. POWER LOSS-50%</p> <p>I FLT. ATTITUDE INST.</p> <p>J WARNING INDICATION</p> <p>K FLUID LOSS</p>	<p>L NO TEST</p> <p>M OVER TEMP</p> <p>N FALSE WARNING</p> <p>O OTHER</p> <p>P NO WARNING INDICATION</p> <p>S AFFECTED SYSTEMS</p> <p>T ENGINE CASE PENETRATION</p> <p>X ENGINE FLAMEOUT</p> <p>Y ENGINE STOPPAGE</p> <p>Z SIGNIFICANT FAILURE REPORT</p>	<p>IN INSPIRANT</p> <p>TX TAXI/GHND HDL</p> <p>TAKEOFF</p> <p>CL CLIMB</p> <p>CR CRUISE</p>	<p>DE DESCENT</p> <p>AP APPROACH</p> <p>LD LANDING</p> <p>HO HOVERING</p> <p>UK UNKNOWN</p>	<p>A UNCRCHED LANDING</p> <p>B EMER. DESCENT</p> <p>C ABORTED TAKEOFF</p> <p>D RETURN TO BLOCK</p> <p>E ENGINE SHUTDOWN</p> <p>F ACTIVATE FIRE EXT.</p>	<p>G MANUAL O2 MASK</p> <p>H DEACTIVATE SYST./CIRCUITS</p> <p>I INFLIGHT DEPRESSURE</p> <p>J QWAF FUEL</p> <p>K HIGH</p> <p>L ABORTED APPROACH</p> <p>O OTHER</p>
NOTE: ENTER ONE TO FOUR CODES IN WHATIVER ORDER MOST ESSENTIAL FIRST OF THE PRECAUTIONARY PROCEDURE.					
NOTE: ENTER STAGE OF FLIGHT OR GROUND OPERATIONS WHEN 15% OCCURRED OR WAS OBTAINED.					
NOTE: ENTER ONE TO THREE CODES IN WHATIVER ORDER MOST RELEVANT ALL CONDITIONS OBTAINED.					
<p>31 AIR CONDITIONING</p> <p>32 AUTO FLIGHT</p> <p>33 COMMUNICATIONS</p> <p>34 ENGINE EXHAUST</p> <p>35 ENGINE INJECTING</p> <p>36 ENGINE OIL</p> <p>37 ENGINE START</p> <p>38 ENGINE START/STOP</p> <p>39 ENGINE START/STOP</p> <p>40 ENGINE START/STOP</p> <p>41 ENGINE START/STOP</p> <p>42 ENGINE START/STOP</p> <p>43 ENGINE START/STOP</p> <p>44 ENGINE START/STOP</p> <p>45 ENGINE START/STOP</p> <p>46 ENGINE START/STOP</p> <p>47 ENGINE START/STOP</p> <p>48 ENGINE START/STOP</p> <p>49 ENGINE START/STOP</p> <p>50 ENGINE START/STOP</p>	<p>31 AIR CONDITIONING</p> <p>32 AUTO FLIGHT</p> <p>33 COMMUNICATIONS</p> <p>34 ENGINE EXHAUST</p> <p>35 ENGINE INJECTING</p> <p>36 ENGINE OIL</p> <p>37 ENGINE START</p> <p>38 ENGINE START/STOP</p> <p>39 ENGINE START/STOP</p> <p>40 ENGINE START/STOP</p> <p>41 ENGINE START/STOP</p> <p>42 ENGINE START/STOP</p> <p>43 ENGINE START/STOP</p> <p>44 ENGINE START/STOP</p> <p>45 ENGINE START/STOP</p> <p>46 ENGINE START/STOP</p> <p>47 ENGINE START/STOP</p> <p>48 ENGINE START/STOP</p> <p>49 ENGINE START/STOP</p> <p>50 ENGINE START/STOP</p>	<p>31 AIR CONDITIONING</p> <p>32 AUTO FLIGHT</p> <p>33 COMMUNICATIONS</p> <p>34 ENGINE EXHAUST</p> <p>35 ENGINE INJECTING</p> <p>36 ENGINE OIL</p> <p>37 ENGINE START</p> <p>38 ENGINE START/STOP</p> <p>39 ENGINE START/STOP</p> <p>40 ENGINE START/STOP</p> <p>41 ENGINE START/STOP</p> <p>42 ENGINE START/STOP</p> <p>43 ENGINE START/STOP</p> <p>44 ENGINE START/STOP</p> <p>45 ENGINE START/STOP</p> <p>46 ENGINE START/STOP</p> <p>47 ENGINE START/STOP</p> <p>48 ENGINE START/STOP</p> <p>49 ENGINE START/STOP</p> <p>50 ENGINE START/STOP</p>	<p>31 AIR CONDITIONING</p> <p>32 AUTO FLIGHT</p> <p>33 COMMUNICATIONS</p> <p>34 ENGINE EXHAUST</p> <p>35 ENGINE INJECTING</p> <p>36 ENGINE OIL</p> <p>37 ENGINE START</p> <p>38 ENGINE START/STOP</p> <p>39 ENGINE START/STOP</p> <p>40 ENGINE START/STOP</p> <p>41 ENGINE START/STOP</p> <p>42 ENGINE START/STOP</p> <p>43 ENGINE START/STOP</p> <p>44 ENGINE START/STOP</p> <p>45 ENGINE START/STOP</p> <p>46 ENGINE START/STOP</p> <p>47 ENGINE START/STOP</p> <p>48 ENGINE START/STOP</p> <p>49 ENGINE START/STOP</p> <p>50 ENGINE START/STOP</p>	<p>31 AIR CONDITIONING</p> <p>32 AUTO FLIGHT</p> <p>33 COMMUNICATIONS</p> <p>34 ENGINE EXHAUST</p> <p>35 ENGINE INJECTING</p> <p>36 ENGINE OIL</p> <p>37 ENGINE START</p> <p>38 ENGINE START/STOP</p> <p>39 ENGINE START/STOP</p> <p>40 ENGINE START/STOP</p> <p>41 ENGINE START/STOP</p> <p>42 ENGINE START/STOP</p> <p>43 ENGINE START/STOP</p> <p>44 ENGINE START/STOP</p> <p>45 ENGINE START/STOP</p> <p>46 ENGINE START/STOP</p> <p>47 ENGINE START/STOP</p> <p>48 ENGINE START/STOP</p> <p>49 ENGINE START/STOP</p> <p>50 ENGINE START/STOP</p>	<p>31 AIR CONDITIONING</p> <p>32 AUTO FLIGHT</p> <p>33 COMMUNICATIONS</p> <p>34 ENGINE EXHAUST</p> <p>35 ENGINE INJECTING</p> <p>36 ENGINE OIL</p> <p>37 ENGINE START</p> <p>38 ENGINE START/STOP</p> <p>39 ENGINE START/STOP</p> <p>40 ENGINE START/STOP</p> <p>41 ENGINE START/STOP</p> <p>42 ENGINE START/STOP</p> <p>43 ENGINE START/STOP</p> <p>44 ENGINE START/STOP</p> <p>45 ENGINE START/STOP</p> <p>46 ENGINE START/STOP</p> <p>47 ENGINE START/STOP</p> <p>48 ENGINE START/STOP</p> <p>49 ENGINE START/STOP</p> <p>50 ENGINE START/STOP</p>

*

APPENDIX 5. SDR SYSTEM MANUFACTURER
IDENTIFICATION CODES

The contents of these manufacturers' code identification listing conform to the Department of Transportation, Federal Aviation Administration, Air Traffic Service Contractions Handbook 7340.1, where possible. The sole purpose of this listing is to provide a standard prefix to the aircraft model number, thus identifying the aircraft/engine manufacturer. They are to be used only in the aircraft type block, the text of the "Problem Description" section of the Service Difficulty Report (FAA Form 8070-1), and the manufacture (MFG) blocks of the Air Carrier Aircraft/Engine Utilization Report (AC Form 8320-1).

FIGURE 1. AIRCRAFT MANUFACTURER IDENTIFICATION CODES

<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>	<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>
Aero Commander	AC	Grumman	G
Aeronca	AR	Hamburger Flugzeugbau	HF
Aerostar	AS	Handley Page	HP
Airbus International	A	Hawker Siddeley	HA
American	AA	Helio	HE
Arctic	AT	Hiller	HL
Avions Marcel Dassault	MD	Howard	HW
Beagle	BT	Hughes	HU
Beech	BE	Hynes	HN
Bell	HB	Industrie Aeronautique	IA
Bellanca	BL	Israel	IL
Boeing	B	Jobmaster	JM
British Aircraft Corp.	BA	Kaman	K
Britten Norman	BN	Kreitzberg	GF
Camair	CM	Lear	LR
Canadair	CL	Lockheed	L
Cessna	C	Luscombe	LU
Consolidated	CO	Martin	M
Convair	CV	Maule	ML
Curtis Wright	CW	McBemas	MB
DeHavilland	DH	McClish	MH
Douglas (McDonnell)	DC	McCulloch	MC
Downer	DO	Mitchell	MT
Enstrom	EN	Mitsubishi	MU
Fairchild	F	Monocoupe	MN
Fairchild Hiller	FH	Mooney	MO
Fletcher	FL	Morane Saulnier	MS
Garcia	TR	Navion	NA
Glasflugel	H	Nihon	YS
Goodyear	GZ	Nord	ND

*

*

FIGURE 1. AIRCRAFT MANUFACTURER IDENTIFICATION CODES (Cont'd)

<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>	<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>
North American	N	Sikorsky	SK
Philco Ford	FR	Smith	SM
Piaggio Renaldo	PR	Societe Nationale	SO
Pilatus	PL	Spartan	SP
Pine Air	PN	Stinson	ST
Piper	PA	Stol	SL
Raven	RA	Sud Aviation	SE
Rawdon	RD	Superior	SU
Reims	RE	Swearingen	SW
Rhein Flugzeugbau	RH	Taylorcraft	TC
Rockwell (North American)	RW	Temco	TE
Roos	RS	Thurston	TH
Rose Aeroplane	RP	Trytek	TK
Ryan	RY	Universal	UN
Scheibe Flugzeugbau	SF	Vertol	VT
Schempp Hirth	S	Vickers	VC
Schleicher	SR	Waco	WA
Schweizer	SC	Weatherly	WE
Short Brothers	SH	Windecker	WD

*

* FIGURE 2. AIRCRAFT MANUFACTURER IDENTIFICATION CODES (ALPHABETICAL)

<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>	<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>
A	Airbus International	L	Lockheed
AA	American	LR	Lear
AC	Aero Commander	LU	Luscombe
AR	Aeronca	M	Martin
AS	Aerostar	MB	McBemas
AT	Arctic	MC	McCulloch
B	Boeing	MD	Avions Marcel Dassault
BA	British Aircraft Corp.	MH	McClish
BE	Beech	ML	Maule
BL	Bellanca	MN	Monocoupe
BN	Britten Norman	MO	Mooney
BT	Beagle	MS	Morane Saulnier
C	Cessna	MT	Mitchell
CL	Canadair	MU	Mitsubishi
CM	Camair	N	North American
CO	Consolidated	NA	Navion
CV	Convair	ND	Nord
CW	Curtis Wright	PA	Piper
DC	Douglas (McDonnell)	PL	Pilatus
DH	DeHavilland	PN	Pine Air
DO	Downer	PR	Piaggio Renaldo
EN	Enstrom	RA	Raven
F	Fairchild	RD	Rawdon
FH	Fairchild Hiller	RE	Reims
FL	Fletcher	RH	Rhein Flugzeugbau
FR	Philco Ford	RP	Rose Aeroplane
G	Grumman	RS	Roos
GF	Kreitzberg	RW	Rockwell (North American)
GZ	Goodyear	RY	Ryan
H	Glasflugel	S	Schempp Hirth
HA	Hawker Siddeley	SC	Schweizer
HB	Bell	SE	Sud Aviation
HE	Helio	SF	Scheibe Flugzeugbau
HF	Hamburger Flugzeugbau	SH	Short Brothers
HP	Handley Page	SK	Sikorsky
HL	Hiller	SL	Stol
HN	Hynes	SM	Smith
HU	Hughes	SO	Societe Nationale
HW	Howard	SP	Spartan
IA	Industrie Aeronautiche	SR	Schleicher
IL	Israel	ST	Stinson
JM	Jobmaster	SU	Superior
K	Kaman	SW	Swearingen

*

* FIGURE 2. AIRCRAFT MANUFACTURER IDENTIFICATION CODES (ALPHABETICAL) (Cont'd)

<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>	<u>Acft</u> <u>Mfr</u>	<u>Mfr</u> <u>Code</u>
TC	Taylorcraft	VC	Vickers
TE	Temco	VT	Vertol
TH	Thurston	WA	Waco
TK	Trytek	WD	Windecker
TR	Garcia	WE	Weatherly
UN	Universal	YS	Nihon

*

*

FIGURE 3. ENGINE MANUFACTURER IDENTIFICATION CODESCODE

ARCH	Airesearch Manufacturing Company
ALSN	Allison Division, General Motors Corporation
CONT	Teledyne Continental Motors
FKLN	Franklin Engine Company, Incorporated
GE	General Electric Company
JCOB	Jacobs Aircraft Engine Company
LYC	Lycoming Division of AVCO Corporation
PWA	Pratt & Whitney Aircraft Division of United Aircraft Corporation, Division of United Technology Corporation, and United Aircraft of Canada
RR	Rolls Royce, Limited
TMCA	Turbomeca
WAD	Wright Aeronautical Division

*

